

Earth Strata Geotechnical Services, Inc.

Geotechnical, Environmental and Materials Testing Consultants

January 8, 2021

Project No. 203131-10A

Mr. Alex Hann
EMPIRE DESIGN GROUP, INC.
24861 Washington Avenue
Murrieta, CA 92562


Subject: **Revised Updated Preliminary Geotechnical Investigation Report, Proposed Commercial Development, PEN19-0039 Through PEN19-0045, Assessor's Parcel Number 479-631-010, Located at the Northwest Corner of Alessandro Boulevard and Lasselle Street, City of Moreno Valley, Riverside County, California**

Earth Strata Geotechnical Services is pleased to present our update to the geotechnical investigation report for the proposed commercial development, Assessor's Parcel Number 479-631-010, located at the northwest corner of Alessandro Boulevard and Lasselle Street in the City of Moreno Valley, Riverside County, California. This work was performed in accordance with the scope of work described in our proposal, dated March 27, 2020. The purpose of this study is to update and re-evaluate the nature, distribution, engineering properties, and geologic strata underlying the site with respect to geotechnical investigation report prepared by Geoboden Inc.


Earth Strata Geotechnical Services appreciates the opportunity to offer our consultation and advice on this project. In the event that you have any questions, please do not hesitate to contact the undersigned at your earliest convenience.

Respectfully submitted,

EARTH STRATA GEOTECHNICAL SERVICES


Stephen M. Poole, PE, GE
Principal Engineer




Aaron G. Wood, PG, CEG
Principal Geologist



SMP/jmr/hr

Distribution: (2) Addressee

42184 REMINGTON AVENUE, TEMECULA, CA 92590 951-461-4028, ESGSINC.COM

TABLE OF CONTENTS

| <u>Section</u> | <u>Page</u> |
|--|-------------|
| INTRODUCTION | 1 |
| SITE DESCRIPTION | 1 |
| PROPOSED DEVELOPMENT AND GRADING..... | 1 |
| FIELD EXPLORATION AND LABORATORY TESTING..... | 3 |
| Field Exploration..... | 3 |
| Laboratory Testing..... | 3 |
| FINDINGS..... | 3 |
| Regional Geology..... | 3 |
| Local Geology | 4 |
| Faulting..... | 6 |
| Landslides..... | 6 |
| CONCLUSIONS AND RECOMMENDATIONS..... | 6 |
| General | 6 |
| Earthwork..... | 7 |
| Earthwork and Grading | 7 |
| Clearing and Grubbing | 7 |
| Excavation Characteristics..... | 7 |
| Groundwater..... | 7 |
| Ground Preparation for Fill Areas..... | 7 |
| Wet Removals..... | 8 |
| Oversize Rock | 8 |
| Compacted Fill Placement..... | 8 |
| Import Earth Materials | 8 |
| Fill Slopes..... | 8 |
| Cut Slopes..... | 9 |
| Stabilization Fills..... | 9 |
| Fill Over Cut Slopes..... | 9 |
| Temporary Backcuts..... | 9 |
| Cut/Fill Transitions | 9 |
| Cut Areas..... | 10 |
| Shrinkage, Bulking and Subsidence | 10 |
| Geotechnical Observations | 10 |
| Post Grading Considerations | 10 |
| Slope Landscaping and Maintenance | 10 |
| Site Drainage | 11 |
| Utility Trenches..... | 11 |
| SEISMIC DESIGN CONSIDERATIONS..... | 11 |
| Ground Motions..... | 11 |
| Secondary Seismic Hazards | 12 |
| Liquefaction and Lateral Spreading..... | 13 |
| TENTATIVE FOUNDATION DESIGN RECOMMENDATIONS..... | 13 |
| General | 13 |
| Allowable Bearing Values..... | 13 |
| Settlement..... | 13 |

| | |
|---|----|
| Lateral Resistance | 14 |
| Structural Setbacks and Building Clearance | 14 |
| Foundation Observations | 15 |
| Expansive Soil Considerations | 16 |
| Very Low Expansion Potential (Expansion Index of 20 or Less) | 16 |
| Footings | 16 |
| Building Floor Slabs | 16 |
| Corrosivity | 17 |
| RETAINING WALLS | 18 |
| Active and At-Rest Earth Pressures | 18 |
| Subdrain System | 18 |
| Temporary Excavations | 19 |
| Retaining Wall Backfill | 19 |
| CONCRETE FLATWORK | 19 |
| Thickness and Joint Spacing | 19 |
| Subgrade Preparation | 19 |
| PRELIMINARY ASPHALTIC CONCRETE PAVEMENT DESIGN | 20 |
| GRADING PLAN REVIEW AND CONSTRUCTION SERVICES | 20 |
| REPORT LIMITATIONS | 21 |

Attachments:

- Figure 1 – Vicinity Map (Page 2)
- Figure 2 – Regional Geologic Map (Page 5)
- APPENDIX A – References (Rear of Text)
- APPENDIX B – Exploratory Logs (Rear of Text)
- APPENDIX C – Laboratory Procedures and Test Results (Rear of Text)
- APPENDIX D – Seismicity (Rear of Text)
- APPENDIX E – General Earthwork and Grading Specifications (Rear of Text)
- Plate 1 – Geotechnical Map (Rear of Text)

INTRODUCTION

Earth Strata Geotechnical Services is pleased to present our updated preliminary geotechnical investigation report for the proposed development. The purpose of this study was to evaluate the nature, distribution, engineering properties, and geologic strata underlying the site with respect to the proposed development, and then provide preliminary grading and foundation design recommendations based on the plans you provided. The general location of the subject property is indicated on the Vicinity Map, Figure 1. The plans you provided were used as the base map to show geologic conditions within the subject site, see Geotechnical Map, Plate 1.

SITE DESCRIPTION


The subject property is located at the northwest corner of Alessandro Boulevard and Lasselle Street in the City of Moreno Valley, Riverside County, California. The approximate location of the site is shown on the Vicinity Map, Figure 1.

The subject property is comprised of approximately 8.9 acres of undeveloped land. The site has not been graded. Topographic relief at the subject property is relatively low with the terrain being generally flat. Elevations at the site range from approximately 1581 to 1597 feet above mean sea level (msl), for a difference of about 16± feet across the entire site. Drainage within the subject property generally flows to the south.

The site is currently bordered by residential development to the west, Alessandro Boulevard to the south, Lasselle Street to the east, and Timo Street to the north. Most of the vegetation on the site consists of moderate to dense amounts of annual weeds/grasses throughout the subject site.

PROPOSED DEVELOPMENT AND GRADING

The proposed commercial development is expected to consist of concrete, wood or steel framed one- and/or two-story structures utilizing slab on grade construction with associated streets, landscape areas, and utilities. The current development plans include three (3) building pads, a car wash, and fuel pump station positioned throughout the site. The plans provided by you were utilized in our evaluation and form the base for our Geotechnical Map, Plate 1.

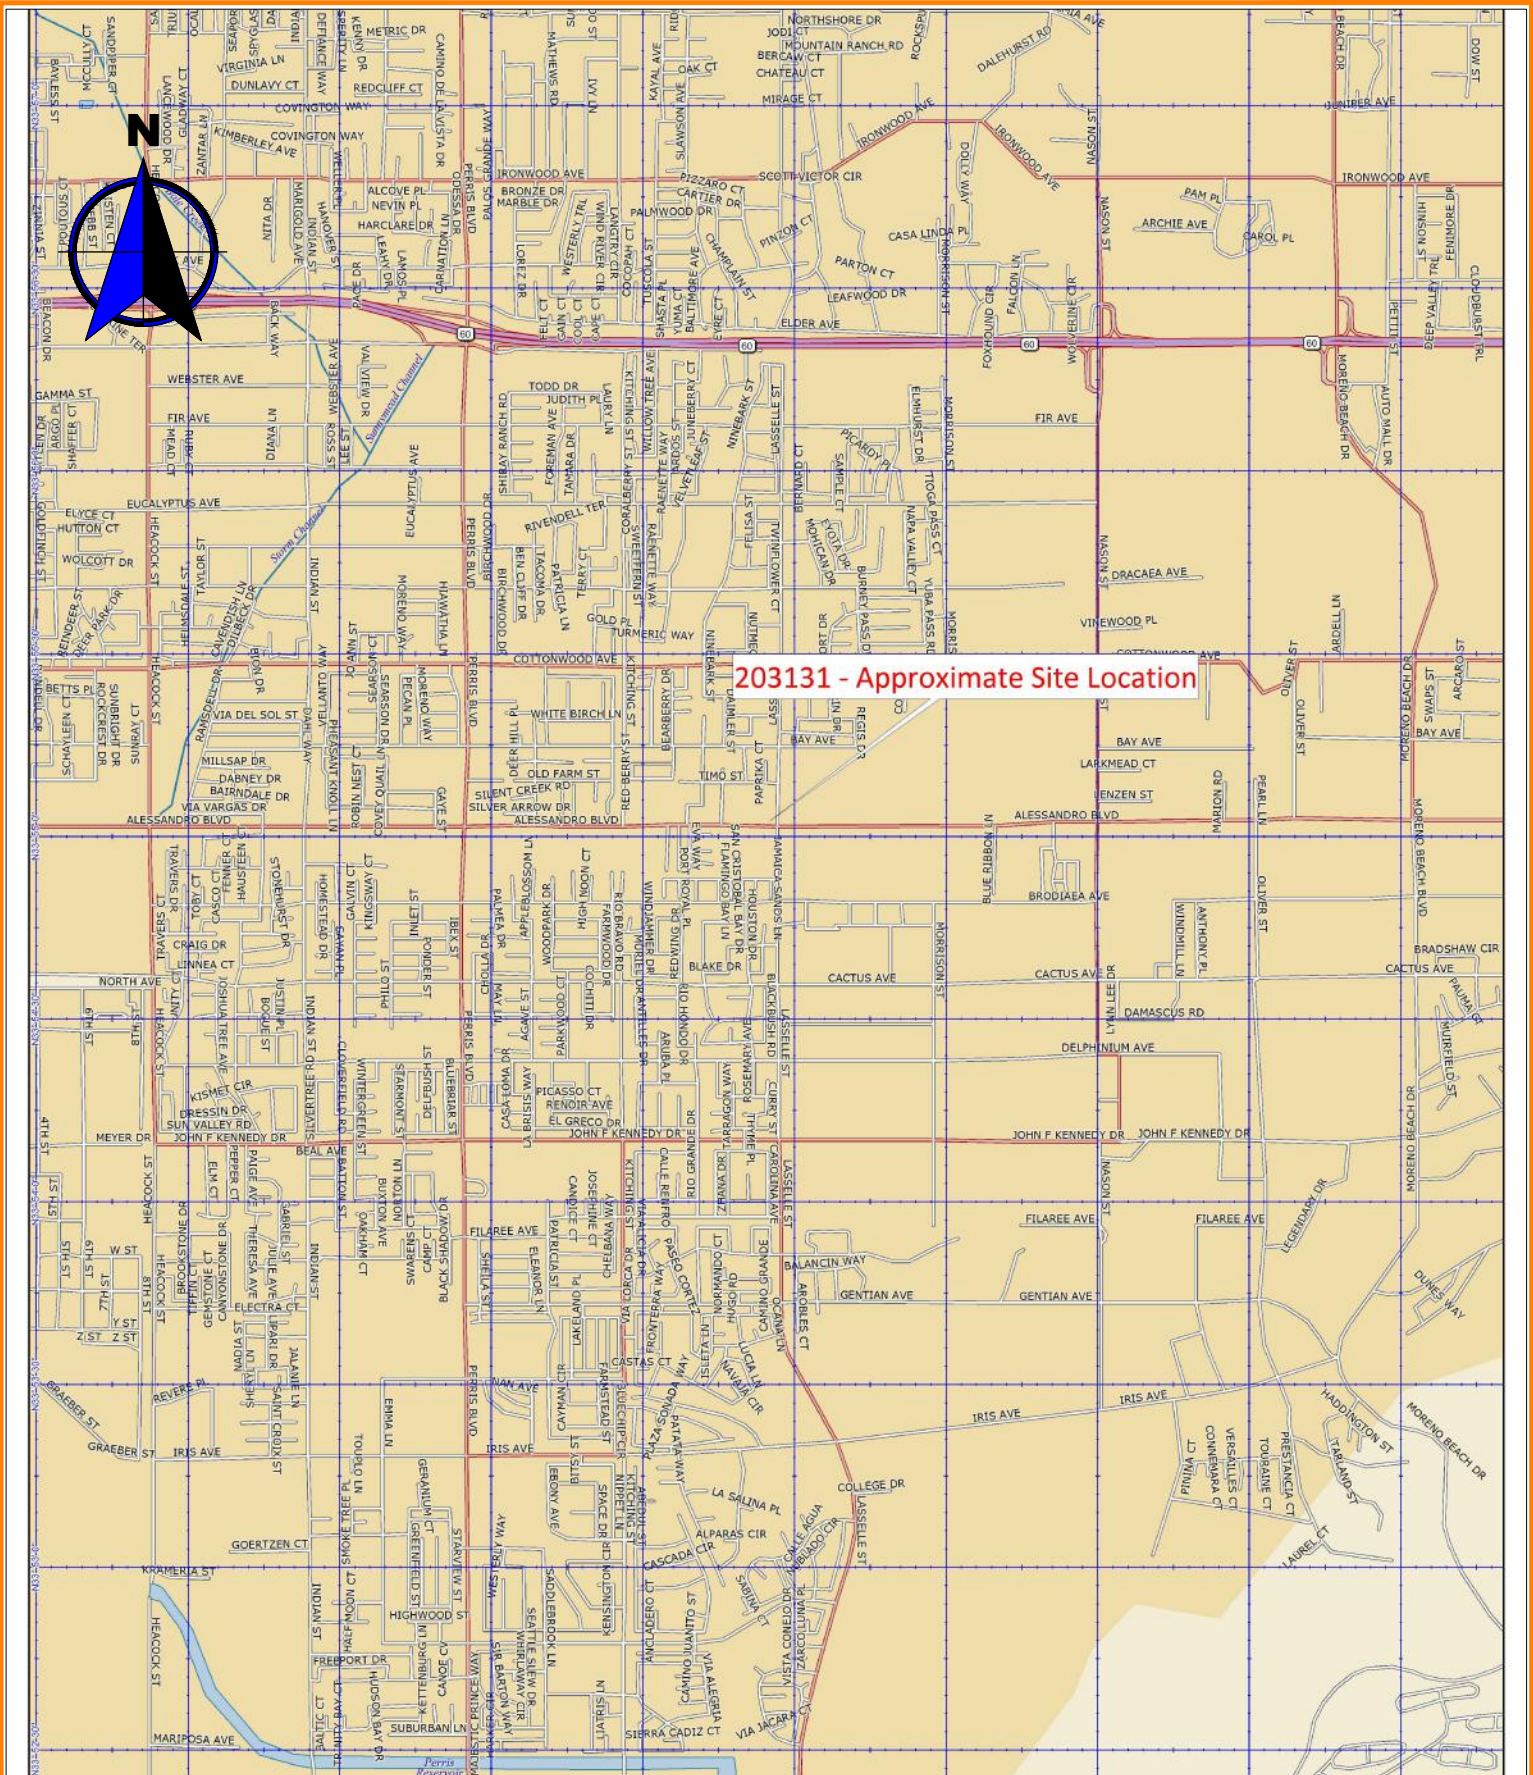

203131 - Approximate Site Location

© 2007 DeLorme (www.delorme.com) Topo USA®.

Earth Strata Geotechnical Services, Inc.
 Geotechnical, Environmental and Materials Testing Consultants
 www.ESGSINC.com (951) 397-8315

LASSELLE STREET
 VICINITY MAP

203131-10A
 SCALE 1:40,625
 JUNE 2020 FIGURE 1

FIELD EXPLORATION AND LABORATORY TESTING

Field Exploration

Subsurface exploration within the subject site was performed by Geoboden Inc., on December 2, 2017 for the exploratory excavations. A truck mounted hollow-stem-auger drill rig was utilized to drill eight (8) borings throughout the site to a maximum depth of 51.5 feet.

Associated with the subsurface exploration was the collection of bulk (disturbed) samples and relatively undisturbed samples of earth materials for laboratory testing and analysis. The relatively undisturbed samples were obtained with a 3 inch outside diameter modified California split-spoon sampler lined with 1-inch-high brass rings. Additional samples were retrieved using a Standard Penetration Test (N) split-spoon sampler. Samples obtained using a hollow stem auger drill rig, were mechanically driven with successive 30 inch drops of a 140-pound automatic trip safety hammer. The blow count per one-foot increment was recorded in the boring logs. The approximate exploratory locations are shown on Plate 1 and descriptive logs are presented in Appendix B.

Laboratory Testing

Maximum dry density/optimum moisture content, expansion potential, pH, resistivity, sulfate content, chloride content, and in-situ density/moisture content were determined by Geoboden Inc., for selected undisturbed and bulk samples of earth materials, considered representative of those encountered. An evaluation of the test data is reflected throughout the Conclusions and Recommendations section of this report. A brief description of laboratory test criteria and summaries of test data are presented in Appendix C.

FINDINGS

Regional Geology


Regionally, the site is located in the Peninsular Ranges Geomorphic Province of California. The Peninsular Ranges are characterized by northwest trending steep mountain ranges separated by sediment filled elongated valleys. The dominant structural geologic features reflect the northwest trend of the province. Associated with and subparallel to the San Andreas Fault are the San Jacinto Fault, Newport-Inglewood, and the Whittier-Elsinore Fault. The Santa Ana Mountains abut the west side of the Elsinore Fault while the Perris Block forms the other side of the fault zone to the east. The Perris Block is bounded to the east by the San Jacinto Fault. The northern perimeter of the Los Angeles basin forms part of a northerly dipping blind thrust fault at the boundary between the Peninsular Ranges Province and the Transverse Range Province.

The mountainous regions within the Peninsular Ranges Province are comprised of Pre-Cretaceous, metasedimentary, and metavolcanic rocks along with Cretaceous plutonic rocks of the Southern California Batholith. The low lying areas are primarily comprised of Tertiary and Quaternary non-marine alluvial sediments consisting of alluvial deposits, sandstones, claystones, siltstones, conglomerates, and occasional volcanic units. A map illustrating the regional geology is presented on the Regional Geologic Map, Figure 2.

Local Geology

The earth materials on the site are primarily comprised of Quaternary alluvial materials and Bedrock. A general description of the dominant earth materials observed on the site is provided below:

- Quaternary Very Old Fan Deposits (map symbol Qvof): Quaternary very old fan deposits were encountered to a maximum depth of 51.5 feet. These alluvial deposits consist predominately of interlayered yellowish brown to brown, fine to coarse grained silty sand and poorly graded sand with gravel. These deposits were generally noted to be in a slightly moist to moist, medium dense to dense state.

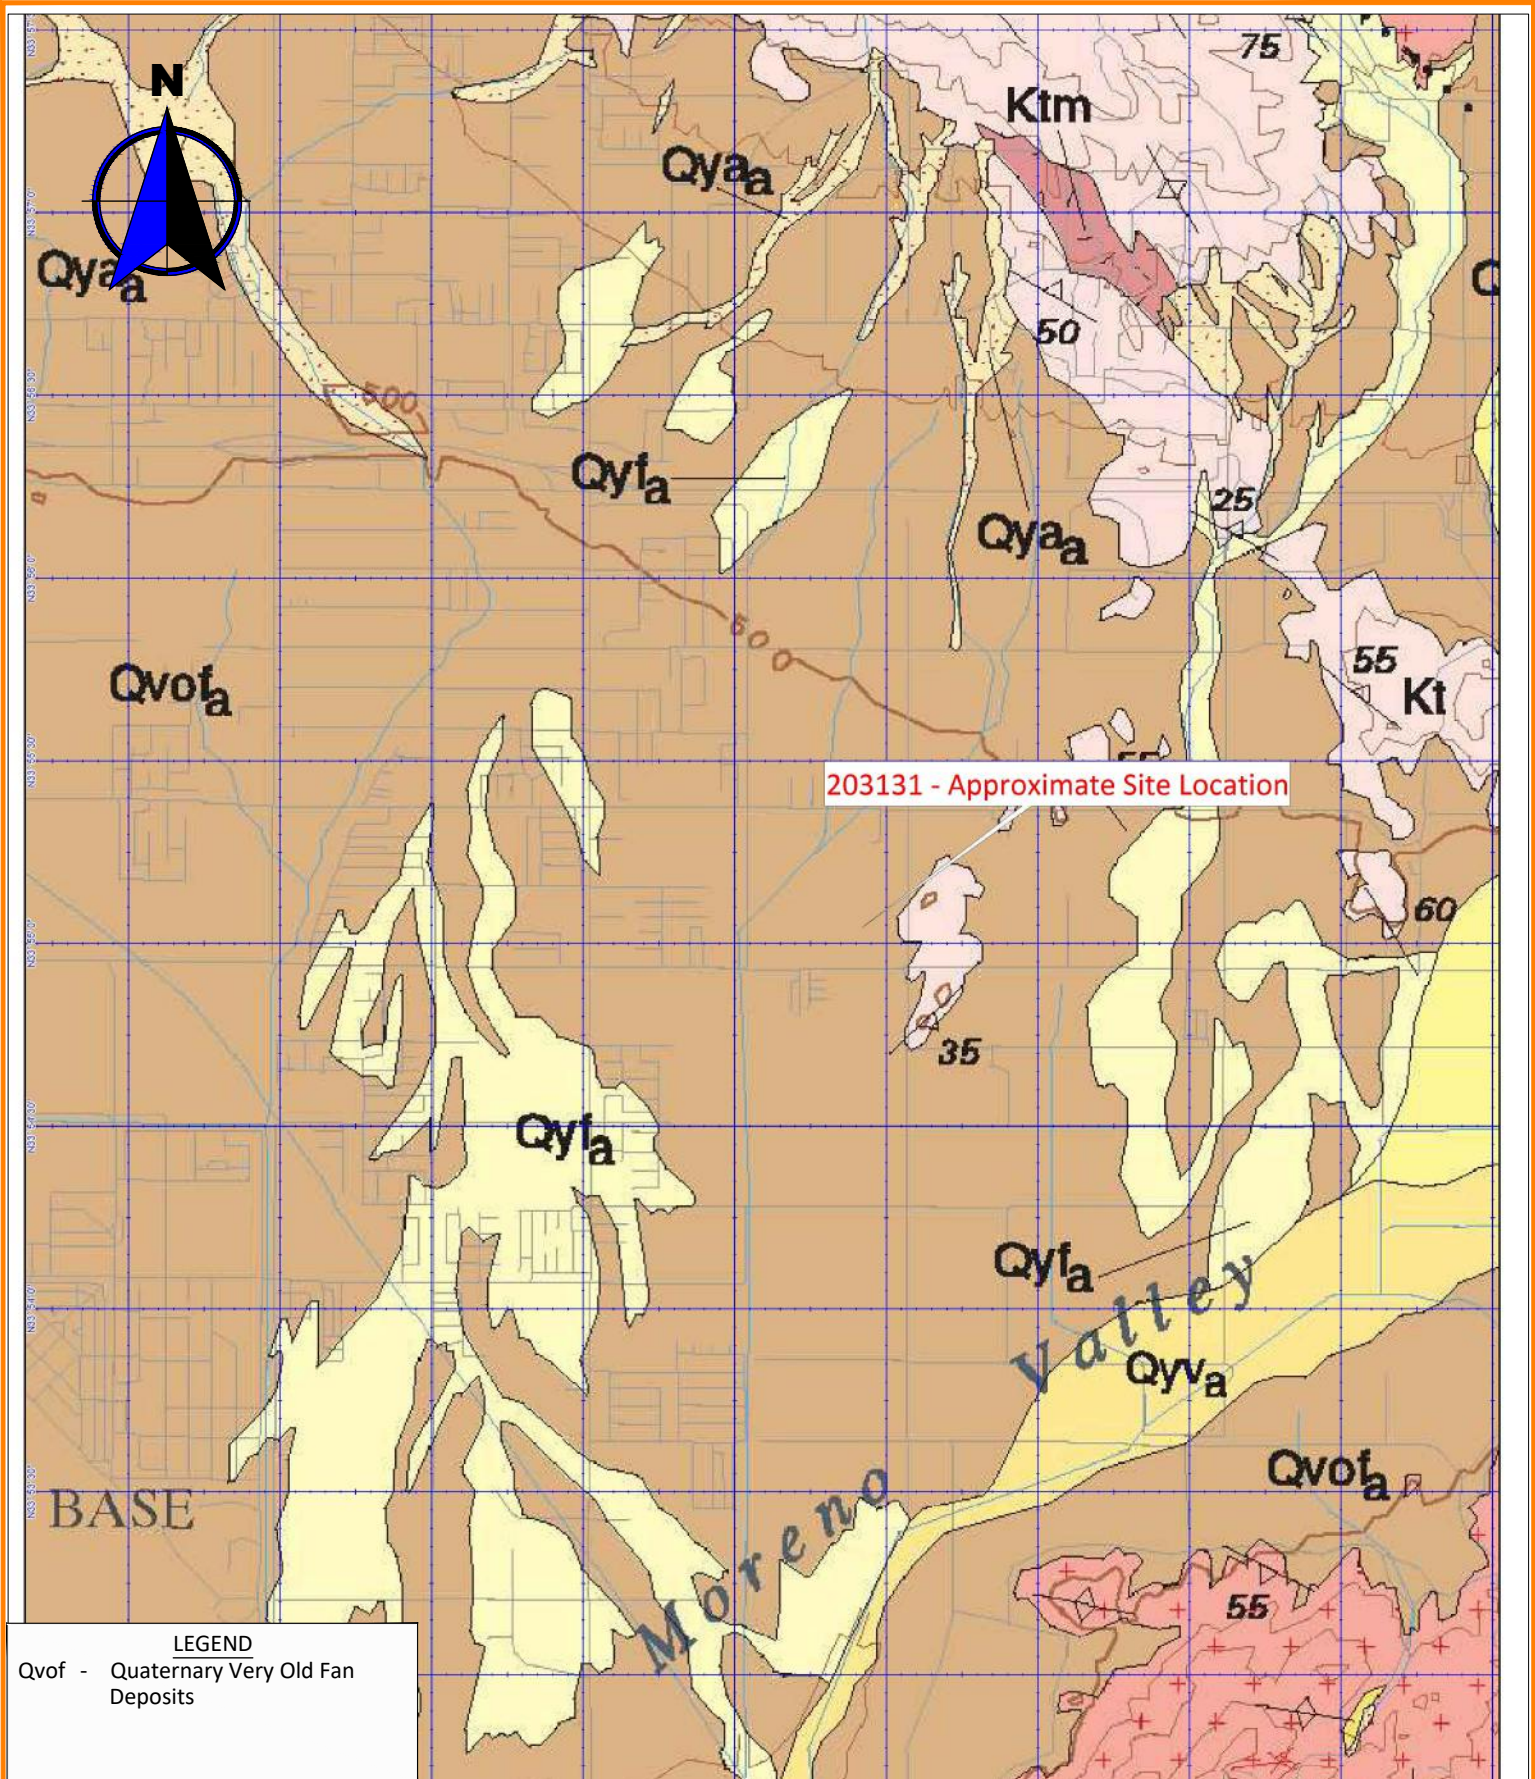

REFERENCES: Morton, D.M., Hauser, Rachel M., and Ruppert, Kelly R., 2004, Preliminary Digital Geologic Map of the San Bernardino and Santa Ana 30' x 60' Quadrangle, Southern California, Version 2.0: U.S. Geological Survey Open-File Report 99-0172.
 "© 2007 DeLorme (www.delorme.com) Topo USA®".

Earth Strata Geotechnical Services, Inc.
 Geotechnical, Environmental and Materials Testing Consultants
 www.ESGSINC.com (951) 397-8315

| | | |
|-----------------------|--|----------------|
| LASELLE STREET | | 203131-10A |
| REGIONAL GEOLOGIC MAP | | SCALE 1:40,625 |
| | | JUNE 2020 |
| | | FIGURE 2 |

Faulting

The project is located in a seismically active region and as a result, significant ground shaking will likely impact the site within the design life of the proposed project. The geologic structure of the entire southern California area is dominated by northwest-trending faults associated with the San Andreas Fault system, which accommodates for most of the right lateral movement associated with the relative motion between the Pacific and North American tectonic plates. Known active faults within this system include the Newport-Inglewood, Whittier-Elsinore, San Jacinto and San Andreas Faults.

No active faults are known to project through the site and the site is not located within an Alquist-Priolo Earthquake Fault Zone, established by the State of California to restrict the construction of new habitable structures across identifiable traces of known active faults. An active fault is defined by the State of California as having surface displacement within the past 11,000 years or during the Holocene geologic time period. Based on our mapping of the subject site, review of current and historical aerial imagery, lack of lineaments indicative of active faulting, and the data compiled during the preparation of this report, it is our interpretation that the potential for surface rupture to adversely impact the proposed structures is very low to remote.

Based on our review of regional geologic maps and applicable computer programs (USGS Seismic Design Maps, Caltrans ARS online, and USGS Earthquake Hazard Programs), the San Jacinto Fault with an approximate source to site distance of 6.73 kilometers is the closest known active fault anticipated to produce the highest ground accelerations, with an anticipated maximum modal magnitude of 7.7. A list of faults as well as a list of significant historical seismic events within a 100km radius of the subject site are included in Appendix D.

Landslides

Landslide debris was not observed during our subsurface exploration and no ancient landslides are known to exist on the site. No landslides are known to exist, or have been mapped, in the vicinity of the site. Geologic mapping of the site conducted during our investigation, and review of aerial imagery of the site, reveal no geomorphic expressions indicative of landsliding.

CONCLUSIONS AND RECOMMENDATIONS

General

From geotechnical and engineering geologic points of view, the subject property is considered suitable for the proposed development, provided the following conclusions and recommendations are incorporated into the plans and are implemented during construction.

Earthwork

Earthwork and Grading

The provisions of the 2019 California Building Code (CBC), including the General Earthwork and Grading Specifications in the last Appendix of this report, should be applied to all earthwork and grading operations, as well as in accordance with all applicable grading codes and requirements of the appropriate reviewing agency. Unless specifically revised or amended herein, grading operations should also be performed in accordance with applicable provisions of our General Earthwork and Grading Specifications within the last appendix of this report.

Clearing and Grubbing

Vegetation including trees, grasses, weeds, brush, shrubs, or any other debris should be stripped from the areas to be graded and properly disposed of offsite. In addition, laborers should be utilized to remove any roots, branches, or other deleterious materials during grading operations.

Earth Strata Geotechnical Services should be notified at the appropriate times to provide observation and testing services during Clearing and Grubbing operations. Any buried structures or unanticipated conditions should be brought to our immediate attention.

Excavation Characteristics

Based on the results of our exploration and experience with similar projects in similar settings, the near surface earth materials, will be readily excavated with conventional earth moving equipment.

Groundwater

Groundwater was not observed during the subsurface exploration performed by Geoboden. It should be noted that localized groundwater could be encountered during grading due to the limited number of exploratory locations or other factors.

Ground Preparation for Fill Areas

For each area to receive compacted fill, the removal of low density, compressible earth materials, such as topsoil, upper alluvial materials, and undocumented artificial fill, should continue until firm competent alluvium is encountered. Removal excavations are subject to verification by the project engineer, geologist or their representative. Prior to placing compacted fills, the exposed bottom in each removal area should be scarified to a depth of 6 inches or more, watered or air dried as necessary to achieve near optimum moisture conditions and then compacted to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557.

The intent of remedial grading is to diminish the potential for hydro-consolidation, slope instability, and/or settlement. Remedial grading should extend beyond the perimeter of the proposed structures a horizontal distance equal to the depth of excavation or a minimum of 5 feet, whichever is greater. For cursory purposes the anticipated removal depths are shown on the enclosed

Geotechnical Map, Plate 1. In general, the anticipated removal depths should vary from 3 to 6 feet below existing grade.

Wet Removals

Wet alluvial materials will probably not be encountered within the low-lying areas of the site. If removals of wet alluvial materials are required, special grading equipment and procedures can greatly reduce overall costs. Careful planning by an experienced grading contractor can reduce the need for special equipment, such as swamp cats, draglines, excavators, pumps, and top loading earthmovers. Possible solutions may include the placement of imported angular rock and/or geotextile ground reinforcement. More specific recommendations can be provided based on the actual conditions encountered. Drying or mixing of wet materials with dry materials will be needed to bring the wet materials to near optimum moisture prior to placing wet materials into compacted fills.

Oversize Rock

Oversize rock should be expected in the mapped area in the northeast portion of the site. Oversize rock that is encountered (i.e., rock exceeding a maximum dimension of 12 inches) should be disposed of offsite or stockpiled onsite and crushed for future use. The disposal of oversize rock is discussed in greater detail in General Earthwork and Grading Specifications within the last appendix of this report.

Compacted Fill Placement

Compacted fill materials should be placed in 6 to 8 inch maximum (uncompacted) lifts, watered or air dried as necessary to achieve uniform near optimum moisture content and then compacted to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557.

Import Earth Materials

Should import earth materials be needed to achieve final design grades, all potential import materials should be free of deleterious/oversize materials, non-expansive, and approved by the project geotechnical consultant prior to delivery onsite.

Fill Slopes

When properly constructed, fill slopes up to 10 feet high with inclinations of 2:1 (h:v) or flatter are considered to be grossly stable. Keyways are required at the toe of all fill slopes higher than 5 feet and steeper than 5:1 (h:v). Keyways should be a minimum of 10 feet wide and 2 feet into competent earth materials, as measured on the downhill side. In order to establish keyway removals, backcuts should be cut no steeper than 1:1 or as recommended by the geotechnical engineer or engineering geologist. Compacted fill should be benched into competent earth materials.

Cut Slopes

When properly constructed, cut slopes into alluvium up to 10 feet high with inclinations of 2:1 (h:v) or flatter are considered grossly stable. Cut slopes should be observed by the engineering geologist or his representative during grading, but are anticipated to be stable.

Stabilization Fills

Currently, stabilization fills will not be required for cut slopes in the alluvium. Our engineering geologist or his representative should be called to evaluate all slopes during grading. In the event that unfavorable geologic conditions are encountered, recommendations for stabilization fills or flatter slopes will be provided.

Fill Over Cut Slopes

The fill portion of fill over cut slopes should not be constructed until the cut portion of the slope has been cut to finish grade. The earth materials and geologic structure exposed along the cut slope should be evaluated with regard to suitability for compacted fills or foundations and for stability. If the cut materials are determined to be competent, then the construction of the keyway and subdrain system may commence or additional remedial recommendations will be provided.

Temporary Backcuts

It is the responsibility of the grading contractor to follow all Cal-OSHA requirements with regard to excavation safety. Where existing developments are upslope, adequate slope stability to protect those developments must be maintained. Temporary backcuts will be required to accomplish removals of unsuitable materials and possibly, to perform canyon removals, stabilization fills, and/or keyways. Backcuts should be excavated at a gradient of 1:1 (h:v) or flatter. Flatter backcuts may be required where geologic structure or earth materials are unfavorable. It is imperative that grading schedules minimize the exposure time of the unsupported excavations. All excavations should be stabilized within 30 days of initial excavation.

Cut/Fill Transitions

Cut/fill transitions should be eliminated from all building areas where the depth of fill placed within the "fill" portion exceeds proposed footing depths. This is to diminish distress to structures resulting from excessive differential settlement. The entire foundation of each structure should be founded on a uniform bearing material. This should be accomplished by overexcavating the "cut" portion and replacing the excavated materials as properly compacted fill. Refer to the following table for recommended depths of overexcavation.

| DEPTH OF FILL ("fill" portion) | DEPTH OF OVEREXCAVATION ("cut" portion) |
|---------------------------------------|--|
| Up to 5 feet | Equal Depth |
| 5 to 10 feet | 5 feet |
| Greater than 10 feet | One-half the thickness of fill placed on the "fill" portion (10 feet maximum) |

Overexcavation of the “cut” portion should extend beyond the building perimeter a horizontal distance equal to the depth of overexcavation or a minimum of 5 feet, whichever is greater.

Cut Areas

In cut areas, an area a minimum of 5 feet beyond the footprint of the proposed structures should overexcavated until; competent bottoms are achieved; to a minimum 3 feet below the proposed foundations; or per the Overexcavation Table above; (whichever is greater) and replaced with compacted fill. Final determination of areas that require overexcavation should be determined in the field by a representative of Earth Strata Geotechnical Services.

Shrinkage, Bulking and Subsidence

Volumetric changes in earth material quantities will occur when poorly consolidated earth materials are replaced with properly compacted fill. Estimates of the percent shrinkage/bulking factors for the various geologic units observed on the subject property are based on in-place densities and on the estimated average percent of relative compaction achieved during grading.

| GEOLOGIC UNIT | SHRINKAGE (%) |
|----------------------|----------------------|
| Alluvium | 10 to 15 |
| Bedrock | 0 to 5 (bulking) |

Subsidence from scarification and recompaction of exposed bottom surfaces is expected to be negligible to approximately 0.01 foot.

The estimates of shrinkage/bulking and subsidence are intended as an aid for project engineers in determining earthwork quantities. Since many variables can affect the accuracy of these estimates, they should be used with caution and contingency plans should be in place for balancing the project.

Geotechnical Observations

Clearing operations, removal of unsuitable materials, and general grading procedures should be observed by the project geotechnical consultant or his representative. No compacted fill should be placed without observations by the geotechnical consultant or his representative to verify the adequacy of the removals.

The project geotechnical consultant or his representative should be present to observe grading operations and to check that minimum compaction requirements and proper lift thicknesses are being met, as well as to verify compliance with the other recommendations presented herein.

Post Grading Considerations

Slope Landscaping and Maintenance

Adequate slope and building pad drainage is essential for the long term performance of the subject site. The gross stability of graded slopes should not be adversely affected, provided all drainage provisions are properly constructed and maintained. Engineered slopes should be landscaped with

deep rooted, drought tolerant maintenance free plant species, as recommended by the project landscape architect.

Site Drainage

Control of site drainage is important for the performance of the proposed project. Roof gutters are recommended for the proposed structures. Pad and roof drainage should be collected and transferred to driveways, adjacent streets, storm-drain facilities, or other locations approved by the building official in non-erosive drainage devices. Drainage should not be allowed to pond on the pad or against any foundation or retaining wall. Drainage should not be allowed to flow uncontrolled over any descending slope. Planters located within retaining wall backfill should be sealed to prevent moisture intrusion into the backfill. Planters located next to structures should be sealed to the depth of the footings. Drainage control devices require periodic cleaning, testing and maintenance to remain effective.

At a minimum, pad drainage should be designed at the minimum gradients required by the CBC. To divert water away from foundations, the ground surface adjacent to foundations should also be graded at the minimum gradients required per the CBC.

Utility Trenches

All utility trench backfill should be compacted at near optimum moisture to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557. For utility trench backfill within pavement areas the upper 6 inches of subgrade materials should be compacted to 95 percent of the maximum dry density determined by ASTM D 1557. This includes within the street right-of-ways, utility easements, under footings, sidewalks, driveways and building floor slabs, as well as within or adjacent to any slopes. Backfill should be placed in approximately 6 to 8 inch maximum loose lifts and then mechanically compacted with a hydro-hammer, rolling with a sheepsfoot, pneumatic tampers, or similar equipment. The utility trenches should be tested by the project geotechnical engineer or their representative to verify minimum compaction requirements are obtained.

In order to minimize the penetration of moisture below building slabs, all utility trenches should be backfilled with compacted fill, lean concrete or concrete slurry where they undercut the perimeter foundation. Utility trenches that are proposed parallel to any building footings (interior and/or exterior trenches), should not be located within a 1:1 (h:v) plane projected downward from the outside bottom edge of the footing.

SEISMIC DESIGN CONSIDERATIONS

Ground Motions

Structures are required to be designed and constructed to resist the effects of seismic ground motions as provided in the 2019 California Building Code Section 1613. The design is dependent on the site class, occupancy category I, II, III, or IV, mapped spectral accelerations for short periods (S_s), and mapped spectral acceleration for a 1-second period (S_1).

In order for structural design to comply with the 2019 CBC, the USGS “US Seismic Design Maps” online tool was used to compile spectral accelerations for the subject property based on data and maps jointly compiled by the United States Geological Survey (USGS) and the California Geological Survey (CGS). The data found in the following table is based on the Maximum Considered Earthquake (MCE) with 5% damped ground motions having a 2% probability of being exceeded in 50 years (2,475 year return period).

The seismic design coefficients were determined by a combination of the site class, mapped spectral accelerations, and occupancy category. The following seismic design coefficients should be implemented during design of the proposed structures. Summaries of the Seismic Hazard Deaggregation graphs and test data are presented in Appendix D.

| 2019 CBC | FACTOR (ASCE 7-16) |
|--|---|
| Site Location | Latitude: 33.918369° (North) Longitude: -117.210555°(West) |
| Site Class | D |
| Mapped Spectral Accelerations for short periods, S_s | 1.728 g |
| Mapped Spectral Accelerations for 1-Second Period, S_1 | 0.675 g |
| Maximum Considered Earthquake Spectral Response Acceleration for Short Periods, S_{ms} | 2.074 g |
| Maximum Considered Earthquake Spectral Response Acceleration for 1-Second Period, S_{m1} | *Null See Section 11.4.8 |
| Design Spectral Response Acceleration for Short Periods, S_{Ds} | 1.382 g |
| Design Spectral Response Acceleration for 1-Second Period, S_{D1} | *Null See Section 11.4.8 |
| Seismic Design Category | D |
| Importance Factor Based on Occupancy Category | II |

*2019 CBC

We performed the probabilistic seismic hazard assessment for the site in accordance with the 2019 CBC, Section 1803.5.11 and 1803.5.12. The probabilistic seismic hazard maps and data files were jointly prepared by the United States Geological Survey (USGS) and the California Geological Survey (CGS) and can be found at the CGS Probabilistic Seismic Hazards Mapping Ground Motion Page. Actual ground shaking intensities at the site may be substantially higher or lower based on complex variables such as the near source directivity effects, depth and consistency of earth materials, topography, geologic structure, direction of fault rupture, and seismic wave reflection, refraction, and attenuation rates. The mean peak ground acceleration was calculated to be 0.877 g.

Secondary Seismic Hazards

Secondary effects of seismic shaking considered as potential hazards include several types of ground failure as well as induced flooding. Different types of ground failure, which could occur as a consequence of severe ground shaking at the site, include landslides, ground lurching, shallow ground rupture, and liquefaction/lateral spreading. The probability of occurrence of each type of ground failure depends on the severity of the earthquake, distance from faults, topography, the state of subsurface earth materials, groundwater conditions, and other factors. Based on our experience, subsurface exploration, and laboratory testing, all of the above secondary effects of seismic activity are considered unlikely.

Seismically induced flooding is normally a consequence of a tsunami (seismic sea wave), a seiche (i.e., a wave-like oscillation of surface water in an enclosed basin that may be initiated by a strong earthquake) or failure of a major reservoir or retention system up gradient of the site. Since the site is at an elevation of more than 1,580 feet above mean sea level and is located more than 42 miles inland from the nearest coastline of the Pacific Ocean, the potential for seismically induced flooding due to a tsunami is considered nonexistent. Since no enclosed bodies of water lie adjacent to or up gradient of the site, the likelihood for induced flooding due to a dam failure or a seiche overcoming the dam's freeboard is considered nonexistent.

Liquefaction and Lateral Spreading

Liquefaction occurs as a result of a substantial loss of shear strength or shearing resistance in loose, saturated, cohesionless earth materials subjected to earthquake induced ground shaking. Potential impacts from liquefaction include loss of bearing capacity, liquefaction related settlement, lateral movements, and surface manifestation such as sand boils. Seismically induced settlement occurs when loose sandy soils become denser when subjected to shaking during an earthquake. The three factors determining whether a site is likely to be subject to liquefaction include seismic shaking, type and consistency of earth materials, and groundwater level. The proposed structures will be supported by compacted fill and competent alluvium, with no shallow groundwater. As such, the potential for earthquake induced liquefaction and lateral spreading beneath the proposed structures is considered very low to remote due to the recommended compacted fill, relatively low groundwater level, and the dense nature of the deeper onsite earth materials.

TENTATIVE FOUNDATION DESIGN RECOMMENDATIONS

General

Provided grading is performed in accordance with the recommendations of this report, shallow foundations are considered feasible for support of the proposed structures. Tentative foundation recommendations are provided herein and graphic presentations of relevant recommendations may also be included on the enclosed map.

Allowable Bearing Values

An allowable bearing value of 2,500 pounds per square foot (psf) is recommended for design of 24-inch square pad footings and 12-inch-wide continuous footings founded at a minimum depth of 12 inches below the lowest adjacent final grade. This value may be increased by 20 percent for each additional 1-foot of width and/or depth to a maximum value of 3,000 psf. Recommended allowable bearing values include both dead and frequently applied live loads and may be increased by one third when designing for short duration wind or seismic forces.

Settlement

Based on the settlement characteristics of the earth materials that underlie the building sites and the anticipated loading, we estimate that the maximum total settlement of the footings will be less than approximately $\frac{3}{4}$ inch. Differential settlement is expected to be about $\frac{1}{2}$ inch over a horizontal distance of

approximately 20 feet, for an angular distortion ratio of 1:480. It is anticipated that the majority of the settlement will occur during construction or shortly after the initial application of loading.

The above settlement estimates are based on the assumption that the grading and construction are performed in accordance with the recommendations presented in this report and that the project geotechnical consultant will observe or test the earth material conditions in the footing excavations.

Lateral Resistance

Passive earth pressure of 250 psf per foot of depth to a maximum value of 2,500 psf may be used to establish lateral bearing resistance for footings. For areas covered with hardscape, passive earth pressure may be taken from the surface. For areas without hardscape, the upper twelve inches of the soil profile must be neglected when calculating passive earth pressure. A coefficient of friction of 0.36 times the dead load forces may be used between concrete and the supporting earth materials to determine lateral sliding resistance. The above values may be increased by one-third when designing for short duration wind or seismic forces. When combining passive and friction for lateral resistance, the passive component should be reduced by one third. In no case shall the lateral sliding resistance exceed one-half the dead load for clay, sandy clay, sandy silty clay, silty clay, and clayey silt.


The above lateral resistance values are based on footings for an entire structure being placed directly against either compacted fill or competent alluvium.

Structural Setbacks and Building Clearance

Structural setbacks are required per the 2019 California Building Code (CBC). Additional structural setbacks are not required due to geologic or geotechnical conditions within the site. Improvements constructed in close proximity to natural or properly engineered and compacted slopes can, over time, be affected by natural processes including gravity forces, weathering, and long term secondary settlement. As a result, the CBC requires that buildings and structures be setback or footings deepened to resist the influence of these processes.

For structures that are planned near ascending and descending slopes, the footings should be embedded to satisfy the requirements presented in the CBC, Section 1808.7 as illustrated in the following Foundation Clearances from Slopes diagram.

FOUNDATION CLEARANCES FROM SLOPES

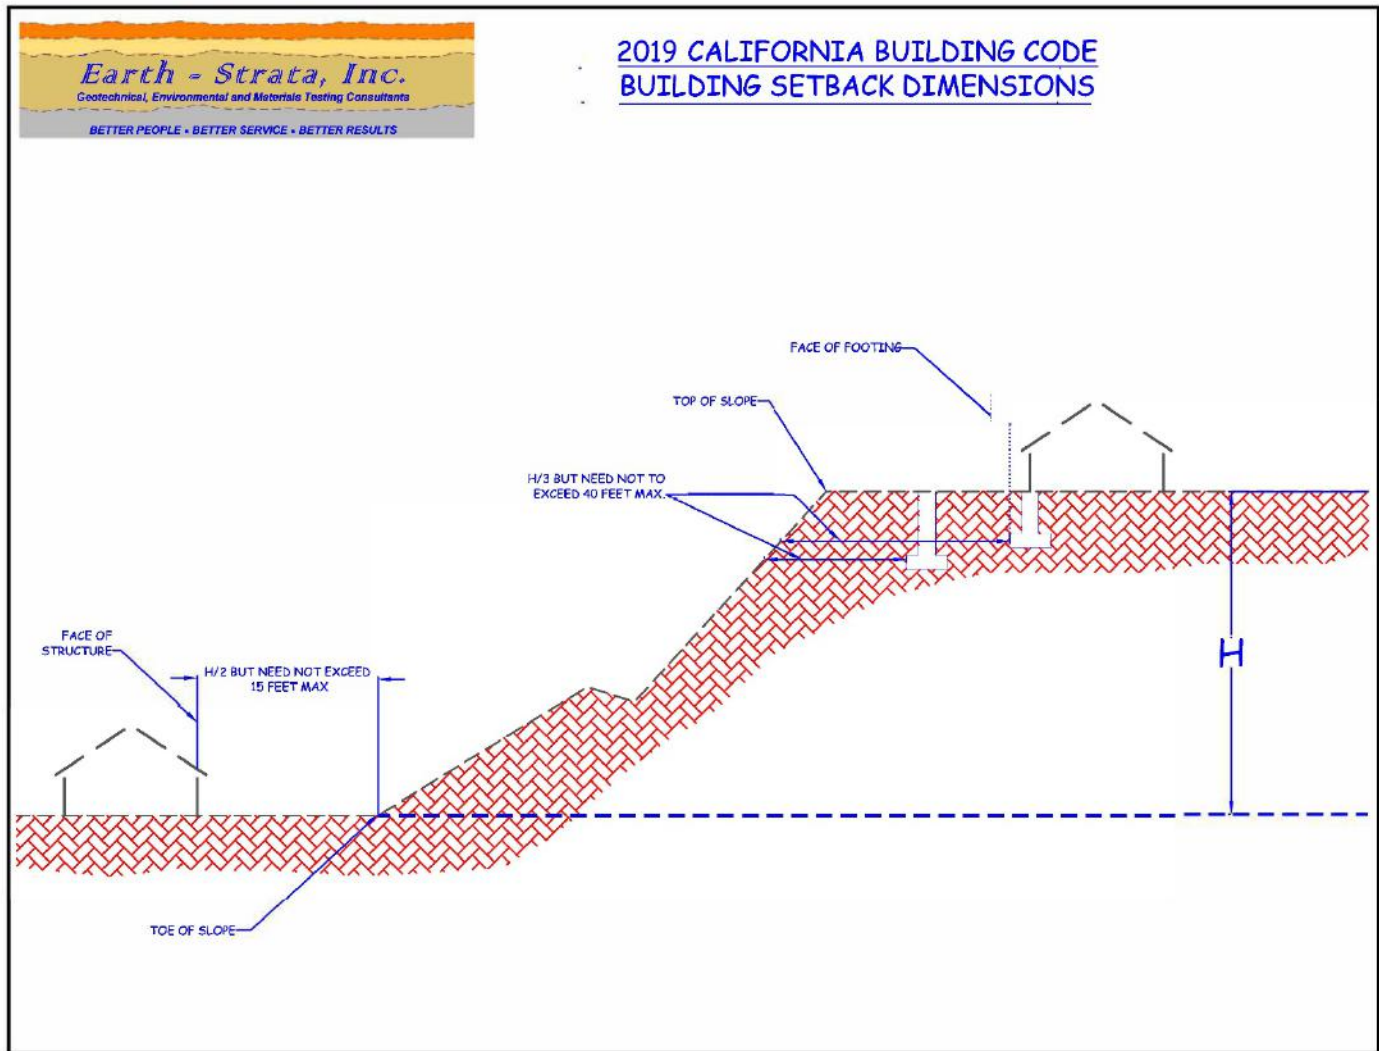

When determining the required clearance from ascending slopes with a retaining wall at the toe, the height of the slope shall be measured from the top of the wall to the top of the slope.

Foundation Observations

In accordance with the 2019 CBC and prior to the placement of forms, concrete, or steel, all foundation excavations should be observed by the geologist, engineer, or his representative to verify that they have been excavated into competent bearing materials. The excavations should be per the approved plans, moistened, cleaned of all loose materials, trimmed neat, level, and square. Any moisture softened earth materials should be removed prior to steel or concrete placement.

Earth materials from foundation excavations should not be placed in slab on grade areas unless the materials are tested for expansion potential and compacted to a minimum of 90 percent of the maximum dry density.

Expansive Soil Considerations

Analysis and review of the boring logs performed by Geoboden indicate onsite earth materials likely exhibit an expansion potential of **VERY LOW** as classified in accordance with 2019 CBC Section 1803.5.3 and ASTM D 4829. Additional, testing for expansive soil conditions should be conducted upon completion of rough grading. The following recommendations should be considered the very minimum requirements, for the earth materials tested. It is common practice for the project architect or structural engineer to require additional slab thickness, footing sizes, and/or reinforcement.

Very Low Expansion Potential (Expansion Index of 20 or Less)

Our laboratory test results indicate that the earth materials onsite exhibit a **VERY LOW** expansion potential as classified in accordance with 2019 CBC Section 1803.5.3 and ASTM D 4829. Since the onsite earth materials exhibit expansion indices of 20 or less, the design of slab on ground foundations is exempt from the procedures outlined in Section 1808.6.1 or 1808.6.2.

Footings

- Exterior continuous footings may be founded at the minimum depths below the lowest adjacent final grade (i.e. 18-inch minimum depth for one and two-story, and 24-inch minimum depth for three-story construction). Interior continuous footings for one-, two-, and three-story construction may be founded at a minimum depth of 12 inches below the lowest adjacent final grade. All continuous footings should have a minimum width of 12, 15, and 18 inches, for one-, two-, and three-story structures, respectively per Table 1809.7 of the 2019 CBC, and should be reinforced with a minimum of four (4) No. 4 bars, two (2) top and two (2) bottom.
- Exterior pad footings intended to support roof overhangs, such as second story decks, patio covers and similar construction should be a minimum of 24 inches square and founded at a minimum depth of 18 inches below the lowest adjacent final grade. No special reinforcement of the pad footings will be required.

Building Floor Slabs

- Building floor slabs should be a minimum of 5 inches thick and reinforced with a minimum of No. 3 bars spaced a maximum of 18 inches on center, each way. All floor slab reinforcement should be supported on concrete chairs or bricks to ensure the desired placement at mid-depth.
- Interior floor slabs, within moisture sensitive areas, should be underlain by a minimum 10-mil thick moisture/vapor barrier to help reduce the upward migration of moisture from the underlying earth materials. The moisture/vapor barrier used should meet the performance standards of an ASTM E 1745 Class A material, and be properly installed in accordance with ACI publication 318. It is the responsibility of the contractor to ensure that the moisture/vapor barriers are free of openings, rips, or punctures prior to placing concrete. As an option for additional moisture reduction, higher strength concrete, such as a minimum 28-day compressive strength of 5,000 pounds per square inch (psi) may be used. Ultimately, the design of the moisture/vapor barrier system and recommendations for concrete placement and curing are the purview of the foundation engineer, taking into consideration the project requirements

provided by the architect and owner.

- Garage floor slabs should be a minimum of 5 inches thick and should be reinforced in a similar manner as living area floor slabs. Garage floor slabs should be placed separately from adjacent wall footings with a positive separation maintained with $\frac{3}{8}$ inch minimum felt expansion joint materials and quartered with weakened plane joints. A 12-inch-wide turn down founded at the same depth as adjacent footings should be provided across garage entrances. The turn down should be reinforced with a minimum of four (4) No. 4 bars, two (2) top and two (2) bottom.
- The subgrade earth materials below all floor slabs should be pre-watered to promote uniform curing of the concrete and minimize the development of shrinkage cracks, prior to placing concrete. The pre-watering should be verified by Earth Strata Geotechnical Services during construction.

Corrosivity

Corrosion is defined by the National Association of Corrosion Engineers (NACE) as “a deterioration of a substance or its properties because of a reaction with its environment.” From a geotechnical viewpoint, the “substances” are the reinforced concrete foundations or buried metallic elements (not surrounded by concrete) and the “environment” is the prevailing earth materials in contact with them. Many factors can contribute to corrosivity, including the presence of chlorides, sulfates, salts, organic materials, different oxygen levels, poor drainage, different soil types, and moisture content. It is not considered practical or realistic to test for all of the factors which may contribute to corrosivity.

The potential for concrete exposure to chlorides is based upon the recognized Caltrans reference standard “Bridge Design Specifications”, under Subsection 8.22.1 of that document, Caltrans has determined that “Corrosive water or soil contains more than 500 parts per million (ppm) of chlorides”. Based on limited laboratory testing, the onsite earth materials have chloride contents *less* than 500 ppm. As such, specific requirements resulting from elevated chloride contents are not required.

Specific guidelines for concrete mix design are provided in 2019 CBC Section 1904.1 and ACI 318, Section 4.3 Table 4.3.1 when the soluble sulfate content of earth materials exceeds 0.1 percent by weight. Based on limited preliminary laboratory testing, the onsite earth materials are classified in accordance with Table 4.3.1 as having a *negligible* sulfate exposure condition. Therefore, structural concrete in contact with onsite earth materials should utilize Type I or II.

Based on laboratory testing of resistivity by Geoboden, the onsite earth materials in contact with buried steel should be considered *moderately corrosive*. Additionally, pH values below 5.6 and above 9.1 are recognized as being corrosive to many common metallic components. The pH values for the earth materials tested were *lower* than 9.1 and *higher* than 5.6.

The preliminary test results for corrosivity are based on limited samples, and the initiation of grading may blend various earth materials together. This blending or imported material could alter and increase the detrimental properties of the onsite earth materials. Accordingly, additional testing for chlorides and sulfates along with testing for pH and resistivity should be performed upon completion of grading. Laboratory test results are presented in Appendix C.

RETAINING WALLS

Active and At-Rest Earth Pressures

Foundations may be designed in accordance with the recommendations provided in the Tentative Foundation Design Recommendation section of this report. The following table provides the minimum recommended equivalent fluid pressures for design of retaining walls a maximum of 8 feet high. The active earth pressure should be used for design of unrestrained retaining walls, which are free to tilt slightly. The at-rest earth pressure should be used for design of retaining walls that are restrained at the top, such as basement walls, curved walls with no joints, or walls restrained at corners. For curved walls, active pressure may be used if tilting is acceptable and construction joints are provided at each angle point and at a minimum of 15 foot intervals along the curved segments.

| MINIMUM STATIC EQUIVALENT FLUID PRESSURES (pcf) | | |
|---|---------------------|-----------|
| PRESSURE TYPE | BACKSLOPE CONDITION | |
| | LEVEL | 2:1 (h:v) |
| Active Earth Pressure | 40 | 63 |
| At-Rest Earth Pressure | 60 | 95 |

The retaining wall parameters provided do not account for hydrostatic pressure behind the retaining walls. Therefore, the subdrain system is a very important part of the design. All retaining walls should be designed to resist surcharge loads imposed by other nearby walls, structures, or vehicles should be added to the above earth pressures, if the additional loads are being applied within a 1.5:1 (h:v) plane projected up from the heel of the retaining wall footing. As a way of minimizing surcharge loads and the settlement potential of nearby buildings, the footings for the building can be deepened below the 1.5:1 (h:v) plane projected up from the heel of the retaining wall footing.

Upon request and under a separate scope of work, more detailed analyses can be performed to address equivalent fluid pressures with regard to stepped retaining walls, actual retaining wall heights, actual backfill inclinations, specific backfill materials, higher retaining walls requiring earthquake design motions, etc.

Subdrain System

We recommend a perforated pipe and gravel subdrain system be provided behind all proposed retaining walls to prevent the buildup of hydrostatic pressure behind the proposed retaining walls. The perforated pipe should consist of 4-inch minimum diameter Schedule 40 PVC or ABS SDR-35, placed with the perforations facing down. The pipe should be surrounded by 1 cubic foot per foot of ¾- or 1½ inch open graded gravel wrapped in filter fabric. The filter fabric should consist of Mirafi 140N or equivalent to prevent infiltration of fines and subsequent clogging of the subdrain system.

In lieu of a perforated pipe and gravel subdrain system, weep holes or open vertical masonry joints may be provided in the lowest row of block exposed to the air to prevent the buildup of hydrostatic pressure behind the proposed retaining walls. Weep holes should be a minimum of 3 inches in diameter and provided at intervals at least every 6 feet along the wall. Open vertical masonry joints should be provided

at a minimum of 32 inch intervals. A continuous gravel fill, a minimum of 1 cubic foot per foot, should be placed behind the weep holes or open masonry joints. The gravel should be wrapped in filter fabric consisting of Mirafi 140N or equivalent.

The retaining walls should be adequately coated on the backfilled side of the walls with a proven waterproofing compound by an experienced professional to inhibit infiltration of moisture through the walls.

Temporary Excavations

All excavations should be made in accordance with Cal-OSHA requirements. Earth Strata Geotechnical Services is not responsible for job site safety.

Retaining Wall Backfill

Retaining wall backfill materials should be approved by the geotechnical engineer or his representative prior to placement as compacted fill. Retaining wall backfill should be placed in lifts no greater than 6 to 8 inches, watered or air dried as necessary to achieve near optimum moisture contents. All retaining wall backfill should be compacted to a minimum of 90 percent of the maximum dry density as determined by ASTM D 1557. Retaining wall backfill should be capped with a paved surface drain.

CONCRETE FLATWORK

Thickness and Joint Spacing

Concrete sidewalks and patio type slabs should be at least 3½ inches thick and provided with construction or expansion joints every 6 feet or less, to reduce the potential for excessive cracking. Concrete driveway slabs should be at least 5 inches thick and provided with construction or expansion joints every 10 feet or less.

Subgrade Preparation

In order to reduce the potential for unsightly cracking, subgrade earth materials underlying concrete flatwork should be compacted at near optimum moisture to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557 and then moistened to optimum or slightly above optimum moisture content. This moisture should extend to a depth of 12 inches below subgrade and be maintained prior to placement of concrete. Pre-watering of the earth materials prior to placing concrete will promote uniform curing of the concrete and minimize the development of shrinkage cracks. The project geotechnical engineer or his representative should verify the density and moisture content of the earth materials and the depth of moisture penetration prior to placing concrete.

Cracking within concrete flatwork is often a result of factors such as the use of too high a water to cement ratio and/or inadequate steps taken to prevent moisture loss during the curing of the concrete. Concrete distress can be reduced by proper concrete mix design and proper placement and curing of the concrete. Minor cracking within concrete flatwork is normal and should be expected.

PRELIMINARY ASPHALTIC CONCRETE PAVEMENT DESIGN

Based on the geotechnical knowledge of the onsite earth material an assumed R-value of 20 may be used for preliminary pavement design. The following table includes our minimum recommended asphaltic concrete pavement sections calculated in accordance with the State of California design procedures using assumed Traffic Indices. Final pavement design should be based on sampling and testing of post grading conditions.

| PRELIMINARY ASPHALTIC CONCRETE PAVEMENT DESIGN | | |
|---|--|--------------------------------------|
| PARAMETERS | MINOR LOCAL PARKING/AUTO DRIVES | COLLECTOR ENTRANCES/DRIVEWAYS |
| Traffic Index | 6.0 | 7.0 |
| Assumed R-Value | 20 | 20 |
| AC Thickness (ft) | *0.25 | *0.30 |
| AB Thickness (ft) | *0.50 | *0.50 |

*Notes minimum section

| PRELIMINARY ASPAHLTIC CONCRETE PAVEMENT DESIGN | | |
|---|------------------------|-----------------------------|
| | Lasselle Street | Alessandro Boulevard |
| PARAMETERS | Minor Arterial | Arterial |
| Traffic Index | 9 | 10 |
| Assumed R-Value | 20 | 20 |
| AC Thickness (ft) | *0.45 | *0.5 |
| AB Thickness (ft) | *0.75 | *1.00 |

*Notes minimum section

Per city requirements coring of the existing sections will be required prior to final design

The subgrade earth materials immediately below the aggregate base (base) should be compacted to a minimum of 95 percent of the maximum dry density determined by ASTM D 1557 to a minimum depth of 12 inches. Base materials should be compacted to a minimum of 95 percent of the maximum dry density determined by ASTM D 1557.

Base materials should consist of Class 2 aggregate base conforming to Section 26-1.02B of the State of California Standard Specifications or crushed aggregate base conforming to Section 200-2 of the Standard Specifications for Public Works Construction (Greenbook). Base materials should be compacted at or slightly below optimum moisture content. Asphaltic concrete materials and construction operations should conform to Section 203 of the Greenbook.

GRADING PLAN REVIEW AND CONSTRUCTION SERVICES

This report has been prepared for the exclusive use of **Mr. Alex Hann** and their authorized representative. It likely does not contain sufficient information for other parties or other uses. Earth Strata Geotechnical Services should be engaged to review the final design plans and specifications prior to construction. This

is to verify that the recommendations contained in this report have been properly incorporated into the project plans and specifications. Should Earth Strata Geotechnical Services not be accorded the opportunity to review the project plans and specifications, we are not responsible for misinterpretation of our recommendations.

We recommend that Earth Strata Geotechnical Services be retained to provide geologic and geotechnical engineering services during grading and foundation excavation phases of the work. In order to allow for design changes in the event that the subsurface conditions differ from those anticipated prior to construction.

Earth Strata Geotechnical Services should review any changes in the project and modify and approve in writing the conclusions and recommendations of this report. This report and the drawings contained within are intended for design input purposes only and are not intended to act as construction drawings or specifications. In the event that conditions encountered during grading or construction operations appear to be different than those indicated in this report, this office should be notified immediately, as revisions may be required.

REPORT LIMITATIONS

Our services were performed using the degree of care and skill ordinarily exercised, under similar circumstances, by reputable soils engineers and geologists, practicing at the time and location this report was prepared. No other warranty, expressed or implied, is made as to the conclusions and professional advice included in this report.

Earth materials vary in type, strength, and other geotechnical properties between points of observation and exploration. Groundwater and moisture conditions can also vary due to natural processes or the works of man on this or adjacent properties. As a result, we do not and cannot have complete knowledge of the subsurface conditions beneath the subject property. No practical study can completely eliminate uncertainty with regard to the anticipated geotechnical conditions in connection with a subject property. The conclusions and recommendations within this report are based upon the findings at the points of observation and are subject to confirmation by Earth Strata Geotechnical Services based on the conditions revealed during grading and construction.

This report was prepared with the understanding that it is the responsibility of the owner or their representative, to ensure that the conclusions and recommendations contained herein are brought to the attention of the other project consultants and are incorporated into the plans and specifications. The owners' contractor should properly implement the conclusions and recommendations during grading and construction, and notify the owner if they consider any of the recommendations presented herein to be unsafe or unsuitable.

APPENDIX A
REFERENCES

APPENDIX A

References

California Building Standards Commission, 2019, *2019 California Building Code, California Code of Regulations Title 24, Part 2, Volume 2 of 2*, Based on 2018 International Building Code.

California Corrosion Guidelines

DeLorme, 2004, (www.delorme.com) *Topo USA*®.

Geoboden Inc., 2017, *Geotechnical Investigation Report, Proposed 76 Gas Station, Northwest Alessandro Boulevard/Lasselle Street, Moreno Valley, California*, Dated December 8.

Morton, D.M., Hauser, Rachel M., and Ruppert, Kelly R., 2004, *Preliminary Digital Geologic Map of the Santa Ana 30' x 60' Quadrangle, Southern California, Version 2.0*: U.S. Geological Survey Open-File Report 99-0172.

Morton, D.M. (compiler), and Fred K. Miller (compiler), 2003, *Preliminary Geologic Map of the San Bernardino 30' x 60' Quadrangle, California*: U.S. Geological Survey Open-File report 03-293, U.S. Geological Survey, Menlo Park, California.

Morton, D.M. (compiler), and Fred K. Miller (compiler), 2006, *Geologic Map of the San Bernardino and Santa Ana 30' x 60' Quadrangles, California*: U.S. Geological Survey, Version 1, California.

National Association of Corrosion Engineers, 1984, *Corrosion Basics An Introduction*, page 191.

Per A.B. Chance® Recommendations, 2003

APPENDIX B
EXPLORATORY LOGS

CLIENT Northwest Moreno Properties Inc
PROJECT NUMBER Moreno Valley-1-01
DATE STARTED 12/2/17 **COMPLETED** 12/2/17
DRILLING CONTRACTOR GeoBoden, Inc.
DRILLING METHOD HSA
LOGGED BY C.R. **CHECKED BY** _____
NOTES _____

PROJECT NAME Proposed 76 Gas Station
PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
GROUND ELEVATION _____ **HOLE SIZE** 8 inches
GROUND WATER LEVELS:
AT TIME OF DRILLING ---
AT END OF DRILLING ---
AFTER DRILLING ---

GEOTECH BH COLUMNS - GINT STD US LAB.GDT - 12/7/17 22:10 - C:\PASSPORT\GBI\76 GAS STATION\LOGS.GPJ

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | SILTY SAND (SM): light brown, dry, ~70% sand, ~20% fines, ~10% gravel | | | | | | | | | | |
| 5 | | POORLY-GRADED SAND w. SILT & GRAVEL (SP-SM): yellowish brown, moist, ~15% fine subrounded gravel up to 1/2 inch, medium to coarse sand, ~10% fines | MC R-1 | | 30 | | 110 | 5 | | | | |
| 10 | | | SS S-2 | | 22 | | | | | | | |
| 15 | | POORLY-GRADED SAND (SP): yellowish brown, moist, ~10% fine to coarse gravel, ~5% fines, ~85% medium to coarse sand | MC R-3 | | 55 | | | | | | | |
| 20 | | POORLY-GRADED SAND w. GRAVEL (SP): yellowish brown, moist, ~15% fine to coarse gravel, ~5% fines, ~80% medium to coarse sand | SS S-4 | | 58 | | | | | | | |
| 25 | | ~30% fine to coarse gravel up to 1 inch, ~5% fines, ~65% medium to coarse sand | SS R-5 | | 60 | | | | | | | |
| 30 | | POORLY-GRADED SAND w. GRAVEL (SP): brown, moist, ~15% fine gravel, ~5% fines, ~80% medium to coarse sand | SS S-6 | | 60 | | | | | | | |
| 35 | | | | | | | | | | | | |

(Continued Next Page)

CLIENT Northwest Moreno Properties Inc **PROJECT NAME** Proposed 76 Gas Station
PROJECT NUMBER Moreno Valley-1-01 **PROJECT LOCATION** Alessandro Boulevard/Laselle Street, Moreno Valley

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) | |
|------------|-------------|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|--|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | | |
| 35 | | POORLY-GRADED SAND w. GRAVEL (SP): brown, moist, ~15% fine gravel, ~5% fines, ~80% medium to coarse sand (continued) | | | | | | | | | | | |
| 40 | | | | | | | | | | | | | |
| 45 | | | | | | | | | | | | | |
| 50 | | | | | | | | | | | | | |

Bottom of borehole at 51.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 51.5 feet.

CLIENT Northwest Moreno Properties Inc
PROJECT NUMBER Moreno Valley-1-01
DATE STARTED 12/2/17 **COMPLETED** 12/2/17
DRILLING CONTRACTOR GeoBoden, Inc.
DRILLING METHOD HSA
LOGGED BY C.R. **CHECKED BY** _____
NOTES _____

PROJECT NAME Proposed 76 Gas Station
PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
GROUND ELEVATION _____ **HOLE SIZE** 8 inches
GROUND WATER LEVELS:
AT TIME OF DRILLING ---
AT END OF DRILLING ---
AFTER DRILLING ---

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | | | | | | | | | | | |
| 5 | | SILTY SAND w. GRAVEL (SM): brown, dry, ~15% fine to coarse gravel, ~55% fine sand, ~30% fines | MC R-1 | | 50 | | 103 | 4 | | | | 51 |
| 10 | | POORLY-GRADED SAND w. SILT & GRAVEL (SP-SM): brown, moist, ~15% fine gravel, ~10% fines, ~75% medium to coarse sand | SS S-2 | | 36 | | | 3 | | | | |
| 15 | | POORLY-GRADED SAND w. GRAVEL (SP): brown, moist, ~30% fine subrounded gravel up to 1/2 inch, ~5% fines, ~65% medium to coarse sand | MC R-3 | | 50 | | 111 | 2 | | | | |

Bottom of borehole at 16.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 16.5 feet.

GEOBODEN, INC.

BORING NUMBER B-3

CLIENT Northwest Moreno Properties Inc
PROJECT NUMBER Moreno Valley-1-01
DATE STARTED 12/2/17 **COMPLETED** 12/2/17
DRILLING CONTRACTOR GeoBoden, Inc.
DRILLING METHOD HSA
LOGGED BY C.R. **CHECKED BY** _____
NOTES _____

PROJECT NAME Proposed 76 Gas Station
PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
GROUND ELEVATION _____ **HOLE SIZE** 8 inches
GROUND WATER LEVELS:
AT TIME OF DRILLING ---
AT END OF DRILLING ---
AFTER DRILLING ---

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | SILTY SAND (SM): brown, dry, ~70% sand, ~30% fines | | | | | | | | | | |
| 5 | | | MC R-1 | | 50 | | 108 | 3 | | | | 52 |
| 10 | | POORLY-GRADED SAND w. SILT & GRAVEL (SP-SM): light yellowish brown, moist, ~15% fine subrounded gravel, ~10% fines, ~75% medium to coarse sand | SS S-2 | | 43 | | | 2 | | | | |
| 15 | | | MC R-3 | | 45 | | 111 | 3 | | | | |

Bottom of borehole at 16.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 16.5 feet.

CLIENT Northwest Moreno Properties Inc
 PROJECT NUMBER Moreno Valley-1-01
 DATE STARTED 12/2/17 COMPLETED 12/2/17
 DRILLING CONTRACTOR GeoBoden, Inc.
 DRILLING METHOD HSA
 LOGGED BY C.R. CHECKED BY _____
 NOTES _____

PROJECT NAME Proposed 76 Gas Station
 PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
 GROUND ELEVATION _____ HOLE SIZE 8 inches
 GROUND WATER LEVELS:
 AT TIME OF DRILLING ---
 AT END OF DRILLING ---
 AFTER DRILLING ---

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|---|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | | | | | | | | | | | |
| | | SILTY SAND (SM): yellowish brown, dry, ~70% sand, ~30% fines | MC R-1 | | 45 | | 107 | 4 | | | | |
| 5 | | POORLY-GRADED SAND w. SILT & GRAVEL (SP-SM): brown, moist, ~15% fine gravel, ~75% medium sand, ~10% fines | MC R-2 | | 38 | | 109 | 6 | | | | |
| 10 | | | MC R-3 | | 43 | | 111 | 4 | | | | |
| 15 | | POORLY-GRADED SAND (SP): yellowish light brown, moist, ~5% fines, ~95% sand | MC R-4 | | 41 | | 110 | 5 | | | | |

Bottom of borehole at 16.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 16.5 feet.

CLIENT Northwest Moreno Properties Inc
 PROJECT NUMBER Moreno Valley-1-01
 DATE STARTED 12/2/17 COMPLETED 12/2/17
 DRILLING CONTRACTOR GeoBoden, Inc.
 DRILLING METHOD HSA
 LOGGED BY C.R. CHECKED BY _____
 NOTES _____

PROJECT NAME Proposed 76 Gas Station
 PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
 GROUND ELEVATION _____ HOLE SIZE 8 inches
 GROUND WATER LEVELS:
 AT TIME OF DRILLING ---
 AT END OF DRILLING ---
 AFTER DRILLING ---


| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|---|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | | | | | | | | | | | |
| 5 | | SILTY SAND w. GRAVEL (SM): brown, moist, ~15% fine gravel, ~30% fines, ~55% medium to coarse sand | MC R-1 | | 39 | | | | | | | |
| 5 | | | MC R-2 | | 43 | | | | | | | |
| 10 | | SAND w. GRAVEL (SP): light brown, moist, ~15% fine to coarse gravel, ~80% fine sand, ~5% fines | MC R-3 | | 46 | | | | | | | |

Bottom of borehole at 11.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 11.5 feet.

CLIENT Northwest Moreno Properties Inc
PROJECT NUMBER Moreno Valley-1-01
DATE STARTED 12/2/17 **COMPLETED** 12/2/17
DRILLING CONTRACTOR GeoBoden, Inc.
DRILLING METHOD HSA
LOGGED BY C.R. **CHECKED BY** _____
NOTES _____

PROJECT NAME Proposed 76 Gas Station
PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
GROUND ELEVATION _____ **HOLE SIZE** 8 inches
GROUND WATER LEVELS:
AT TIME OF DRILLING ---
AT END OF DRILLING ---
AFTER DRILLING ---
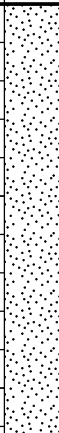
| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|--|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | SAND w. GRAVEL (SP): light brown, moist, ~20% gravel | | | | | | | | | | |
| 5 |  | | MC R-1 | | 43 | | | | | | | |
| | | | MC R-2 | | 45 | | 108 | 2 | | | | |
| 10 | | | MC R-3 | | 46 | | | | | | | |

Bottom of borehole at 11.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 11.5 feet.

CLIENT Northwest Moreno Properties Inc
PROJECT NUMBER Moreno Valley-1-01
DATE STARTED 12/2/17 **COMPLETED** 12/2/17
DRILLING CONTRACTOR GeoBoden, Inc.
DRILLING METHOD HSA
LOGGED BY C.R. **CHECKED BY** _____
NOTES _____

PROJECT NAME Proposed 76 Gas Station
PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
GROUND ELEVATION _____ **HOLE SIZE** 8 inches
GROUND WATER LEVELS:
AT TIME OF DRILLING ---
AT END OF DRILLING ---
AFTER DRILLING ---

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | | | | | | | | | | | |
| | | SILTY SAND (SM): brown, dry, ~70% sand, ~30% fines | MC R-1 | | 35 | | | | | | | |
| 5 | | POORLY-GRADED SAND w. SILT & GRAVEL (SP-SM): light brown, moist, ~15% gravel, ~10% fines, ~75% medium sand | MC R-2 | | 41 | | 109 | 4 | | | | |
| 10 | | | MC R-3 | | 39 | | | | | | | |

Bottom of borehole at 11.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 11.5 feet.

CLIENT Northwest Moreno Properties Inc
PROJECT NUMBER Moreno Valley-1-01
DATE STARTED 12/2/17 **COMPLETED** 12/2/17
DRILLING CONTRACTOR GeoBoden, Inc.
DRILLING METHOD HSA
LOGGED BY C.R. **CHECKED BY** _____
NOTES _____

PROJECT NAME Proposed 76 Gas Station
PROJECT LOCATION Alessandro Boulevard/Laselle Street, Moreno Valley
GROUND ELEVATION _____ **HOLE SIZE** 8 inches
GROUND WATER LEVELS:
AT TIME OF DRILLING ---
AT END OF DRILLING ---
AFTER DRILLING ---

| DEPTH (ft) | GRAPHIC LOG | MATERIAL DESCRIPTION | SAMPLE TYPE NUMBER | RECOVERY % (RQD) | BLOW COUNTS (N VALUE) | POCKET PEN. (tsf) | DRY UNIT WT. (pcf) | MOISTURE CONTENT (%) | ATTERBERG LIMITS | | | FINES CONTENT (%) |
|------------|-------------|--|--------------------|------------------|-----------------------|-------------------|--------------------|----------------------|------------------|---------------|------------------|-------------------|
| | | | | | | | | | LIQUID LIMIT | PLASTIC LIMIT | PLASTICITY INDEX | |
| 0 | | | | | | | | | | | | |
| | | SILTY SAND w. GRAVEL (SM): brown, moist, ~20% fines, ~75% sand, ~5% gravel | MC R-1 | | 34 | | | | | | | |
| 5 | | | MC R-2 | | 41 | | 115 | 2 | | | | |
| 10 | | | MC R-3 | | 45 | | | | | | | |

Bottom of borehole at 11.5 feet below ground surface. Boring was backfilled with cuttings. No groundwater was encountered at the time of drilling.

Bottom of borehole at 11.5 feet.

APPENDIX C

LABORATORY PROCEDURES AND TEST RESULTS

APPENDIX C

Laboratory Procedures and Test Results

Laboratory testing provided quantitative and qualitative data involving the relevant engineering properties of the representative earth materials selected for testing. The representative samples were tested in general accordance with American Society for Testing and Materials (ASTM) procedures and/or California Test Methods (CTM).

Soil Classification: Earth materials encountered during exploration were classified and logged in general accordance with the Standard Practice for Description and Identification of Soils (Visual-Manual Procedure) of ASTM D 2488. Upon completion of laboratory testing, exploratory logs and sample descriptions were reconciled to reflect laboratory test results with regard to ASTM D 2487.

Expansion Index:

| SAMPLE LOCATION | MATERIAL DESCRIPTION | EXPANSION INDEX | EXPANSION POTENTIAL |
|-----------------|----------------------|-----------------|---------------------|
| B-1 @ 0-5 feet | Silty SAND | 10 | Very Low |

Minimum Resistivity and pH Tests: Minimum resistivity and pH Tests of select samples were performed using the guidelines of CTM 643. The test results are presented in the table below.

| SAMPLE LOCATION | MATERIAL DESCRIPTION | pH | MINIMUM RESISTIVITY (ohm-cm) |
|-----------------|----------------------|-----|------------------------------|
| B-1 @ 0-5 feet | Silty SAND | 7.1 | 1769 |

Soluble Sulfate: The soluble sulfate content of select samples was determined using the guidelines of CTM 417. The test results are presented in the table below.

| SAMPLE LOCATION | MATERIAL DESCRIPTION | SULFATE CONTENT (% by weight) | SULFATE EXPOSURE |
|-----------------|----------------------|-------------------------------|------------------|
| B-1 @ 0-5 feet | Silty SAND | 0.0119 | Negligible |

Chloride Content: Chloride content of select samples was determined using the guidelines of CTM 422. The test results are presented in the table below.

| SAMPLE LOCATION | MATERIAL DESCRIPTION | CHLORIDE CONTENT (ppm) |
|-----------------|----------------------|------------------------|
| B-1 @ 0-5 feet | Silty SAND | 39 |


APPENDIX D
SEISMICITY

CALIFORNIA DEPARTMENT OF TRANSPORTATION

Caltrans ARS Online (v2.3.09)

This web-based tool calculates both deterministic and probabilistic acceleration response spectra for any location in California based on criteria provided in [Appendix B of Caltrans Seismic Design Criteria](#). [More...](#)


SELECT SITE LOCATION

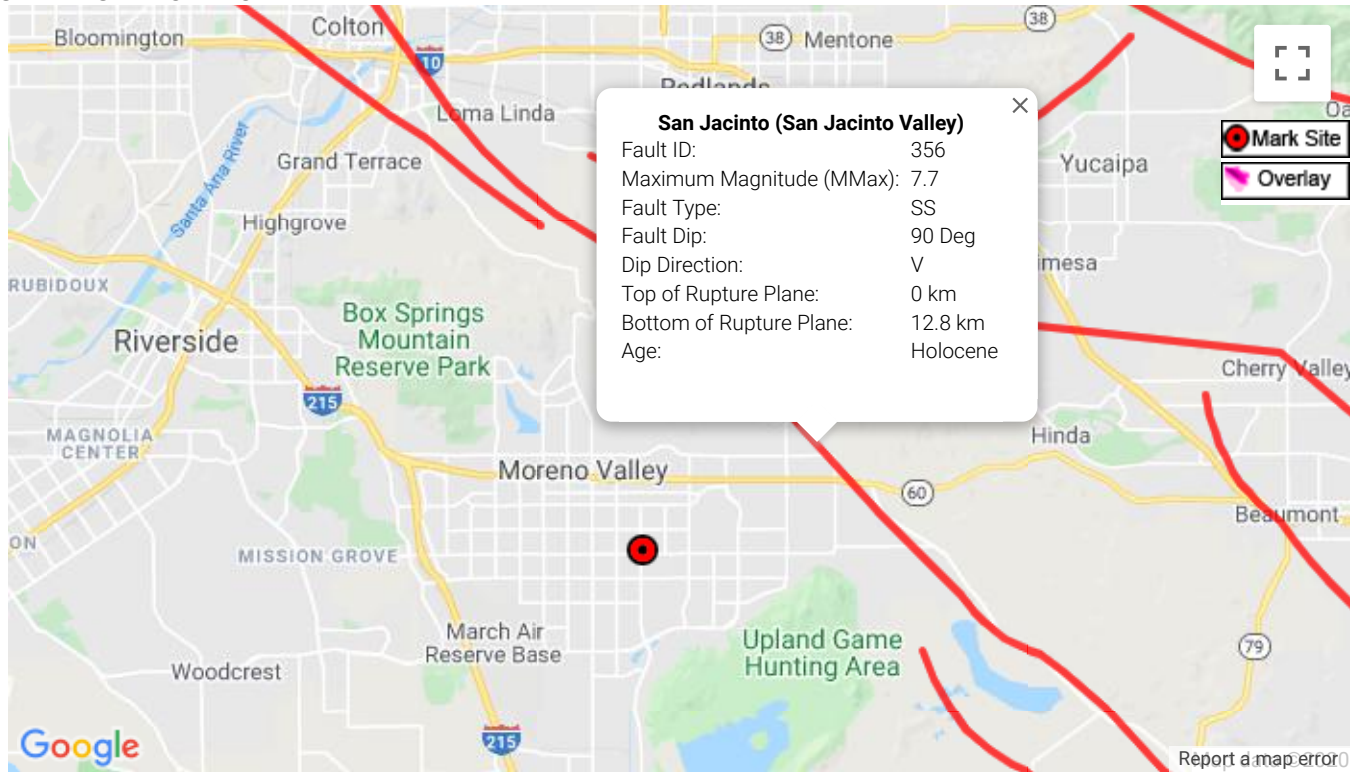

Latitude:
 Longitude:
 Vs30: m/s

CALCULATED SPECTRA

Display Curves: 3

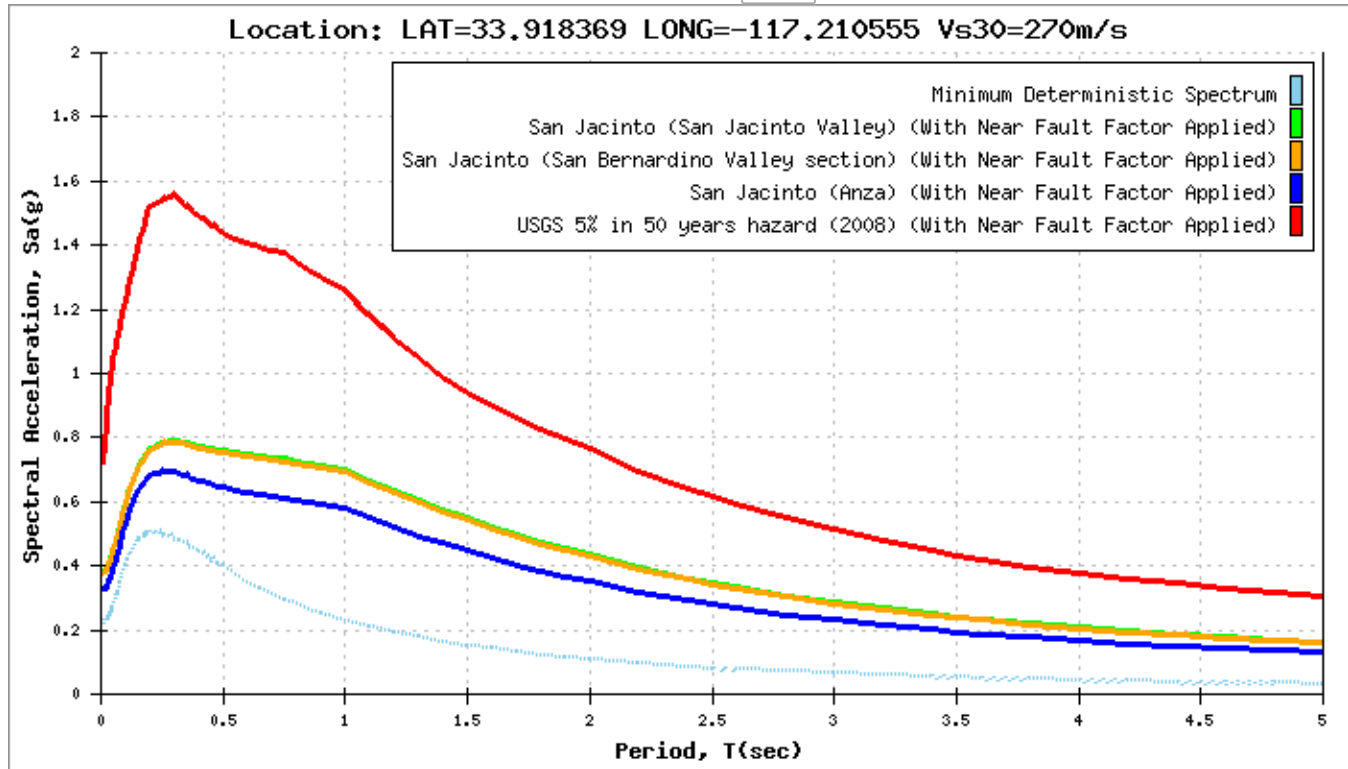

- Tabular Data
- Envelope Only
- Hide Near Fault
- Axis Scale
- Show Basin

Apply Near Fault Adjustment To:

NOTE: Caltrans SDC requires application of a Near Fault Adjustment factor for sites less than 25 km (Rrup) from the causative fault.

Deterministic Spectrum Using

- Km San Jacinto (San Jacinto Valley)
- Km San Jacinto (San Bernardino Valley section)
- Km San Jacinto (Anza)

Probabilistic Spectrum Using

Km (Recommend Performing Deaggregation To Verify)

- Show Spectrum with Adjustment Only
- Show Spectrum with and without near fault Adjustment

This application is being updated for digital accessibility and will continue to function while updates are in progress.

U.S. Geological Survey - Earthquake Hazards Program

2008 National Seismic Hazard Maps - Source Parameters

[New Search](#)

| Distance in Miles | Name | State | Pref Slip Rate (mm/yr) | Dip (degrees) | Dip Dir | Slip Sense | Rupture Top (km) | Rupture Bottom (km) | Length (km) |
|-------------------|---|-------|------------------------|---------------|---------|-------------|------------------|---------------------|-------------|
| 3.99 | San Jacinto;SJV | CA | 18 | 90 | V | strike slip | 0 | 16 | 43 |
| 3.99 | San Jacinto;SBV+SJV+A+CC+B+SM | CA | n/a | 90 | V | strike slip | 0.1 | 15 | 241 |
| 3.99 | San Jacinto;SBV+SJV+A+CC+B | CA | n/a | 90 | V | strike slip | 0.1 | 15 | 215 |
| 3.99 | San Jacinto;SBV+SJV+A+CC | CA | n/a | 90 | V | strike slip | 0 | 16 | 181 |
| 3.99 | San Jacinto;SBV+SJV+A+C | CA | n/a | 90 | V | strike slip | 0 | 17 | 181 |
| 3.99 | San Jacinto;SBV+SJV+A | CA | n/a | 90 | V | strike slip | 0 | 16 | 134 |
| 3.99 | San Jacinto;SBV+SJV | CA | n/a | 90 | V | strike slip | 0 | 16 | 88 |
| 3.99 | San Jacinto;SJV+A+CC+B+SM | CA | n/a | 90 | V | strike slip | 0.1 | 15 | 196 |
| 3.99 | San Jacinto;SJV+A+CC+B | CA | n/a | 90 | V | strike slip | 0.1 | 15 | 170 |
| 3.99 | San Jacinto;SJV+A+CC | CA | n/a | 90 | V | strike slip | 0 | 16 | 136 |
| 3.99 | San Jacinto;SJV+A+C | CA | n/a | 90 | V | strike slip | 0 | 17 | 136 |
| 3.99 | San Jacinto;SJV+A | CA | n/a | 90 | V | strike slip | 0 | 17 | 89 |
| 6.13 | San Jacinto;A+CC+B | CA | n/a | 90 | V | strike slip | 0.1 | 15 | 152 |
| 6.13 | San Jacinto;A+CC | CA | n/a | 90 | V | strike slip | 0 | 16 | 118 |
| 6.13 | San Jacinto;A+C | CA | n/a | 90 | V | strike slip | 0 | 17 | 118 |
| 6.13 | San Jacinto;A | CA | 9 | 90 | V | strike slip | 0 | 17 | 71 |
| 6.13 | San Jacinto;A+CC+B+SM | CA | n/a | 90 | V | strike slip | 0.1 | 15 | 178 |

| | | | | | | | | | |
|-------|--|----|-----|----|---|-------------|-----|----|-----|
| 6.98 | San Jacinto;SBV | CA | 6 | 90 | V | strike slip | 0 | 16 | 45 |
| 14.31 | S. San Andreas;NM+SM+NSB+SSB+BG+CO | CA | n/a | 84 | | strike slip | 0.1 | 13 | 340 |
| 14.31 | S. San Andreas;BB+NM+SM+NSB+SSB+BG+CO | CA | n/a | 85 | | strike slip | 0.1 | 13 | 390 |
| 14.31 | S. San Andreas;BB+NM+SM+NSB+SSB+BG | CA | n/a | 84 | | strike slip | 0 | 14 | 321 |
| 14.31 | S. San Andreas;BB+NM+SM+NSB+SSB | CA | n/a | 90 | V | strike slip | 0 | 14 | 263 |
| 14.31 | S. San Andreas;SSB+BG+CO | CA | n/a | 77 | | strike slip | 0.2 | 12 | 170 |
| 14.31 | S. San Andreas;SSB | CA | 16 | 90 | V | strike slip | 0 | 13 | 43 |
| 14.31 | S. San Andreas;SM+NSB+SSB+BG+CO | CA | n/a | 83 | | strike slip | 0.1 | 13 | 303 |
| 14.31 | S. San Andreas;SM+NSB+SSB+BG | CA | n/a | 81 | | strike slip | 0 | 13 | 234 |
| 14.31 | S. San Andreas;CH+CC+BB+NM+SM+NSB+SSB+BG+CO | CA | n/a | 86 | | strike slip | 0.1 | 13 | 512 |
| 14.31 | S. San Andreas;SSB+BG | CA | n/a | 71 | | strike slip | 0 | 13 | 101 |
| 14.31 | S. San Andreas;NSB+SSB+BG+CO | CA | n/a | 79 | | strike slip | 0.2 | 12 | 206 |
| 14.31 | S. San Andreas;SM+NSB+SSB | CA | n/a | 90 | V | strike slip | 0 | 13 | 176 |
| 14.31 | S. San Andreas;PK+CH+CC+BB+NM+SM+NSB+SSB+BG+CO | CA | n/a | 86 | | strike slip | 0.1 | 13 | 548 |
| 14.31 | S. San Andreas;PK+CH+CC+BB+NM+SM+NSB+SSB+BG | CA | n/a | 86 | | strike slip | 0.1 | 13 | 479 |
| 14.31 | S. San Andreas;PK+CH+CC+BB+NM+SM+NSB+SSB | CA | n/a | 90 | V | strike slip | 0.1 | 13 | 421 |
| 14.31 | S. San Andreas;CC+BB+NM+SM+NSB+SSB | CA | n/a | 90 | V | strike slip | 0 | 14 | 322 |
| 14.31 | S. San Andreas;CC+BB+NM+SM+NSB+SSB+BG | CA | n/a | 85 | | strike slip | 0 | 14 | 380 |
| 14.31 | S. San Andreas;CC+BB+NM+SM+NSB+SSB+BG+CO | CA | n/a | 86 | | strike slip | 0.1 | 13 | 449 |
| 14.31 | S. San Andreas;CH+CC+BB+NM+SM+NSB+SSB | CA | n/a | 90 | V | strike slip | 0 | 14 | 384 |
| 14.31 | S. San Andreas;CH+CC+BB+NM+SM+NSB+SSB+BG | CA | n/a | 86 | | strike slip | 0 | 14 | 442 |
| 14.31 | S. San Andreas;NSB+SSB+BG | CA | n/a | 75 | | strike | 0 | 14 | 136 |

| | | | | | | slip | | | |
|-------|--|----|-----|----|----|-------------|-----|----|-----|
| 14.31 | S. San Andreas;NSB+SSB | CA | n/a | 90 | V | strike slip | 0 | 13 | 79 |
| 14.31 | S. San Andreas;NM+SM+NSB+SSB | CA | n/a | 90 | V | strike slip | 0 | 13 | 213 |
| 14.31 | S. San Andreas;NM+SM+NSB+SSB+BG | CA | n/a | 83 | | strike slip | 0 | 14 | 271 |
| 15.99 | S. San Andreas;NM+SM+NSB | CA | n/a | 90 | V | strike slip | 0 | 13 | 170 |
| 15.99 | S. San Andreas;NSB | CA | 22 | 90 | V | strike slip | 0 | 13 | 35 |
| 15.99 | S. San Andreas;CC+BB+NM+SM+NSB | CA | n/a | 90 | V | strike slip | 0 | 14 | 279 |
| 15.99 | S. San Andreas;PK+CH+CC+BB+NM+SM+NSB | CA | n/a | 90 | V | strike slip | 0.1 | 13 | 377 |
| 15.99 | S. San Andreas;CH+CC+BB+NM+SM+NSB | CA | n/a | 90 | V | strike slip | 0 | 14 | 341 |
| 15.99 | S. San Andreas;SM+NSB | CA | n/a | 90 | V | strike slip | 0 | 13 | 133 |
| 15.99 | S. San Andreas;BB+NM+SM+NSB | CA | n/a | 90 | V | strike slip | 0 | 14 | 220 |
| 18.45 | Elsinore;GI+T+J | CA | n/a | 86 | NE | strike slip | 0 | 17 | 153 |
| 18.45 | Elsinore;GI+T | CA | 5 | 90 | V | strike slip | 0 | 14 | 78 |
| 18.45 | Elsinore;W+GI+T+J+CM | CA | n/a | 84 | NE | strike slip | 0 | 16 | 241 |
| 18.45 | Elsinore;W+GI+T+J | CA | n/a | 84 | NE | strike slip | 0 | 16 | 199 |
| 18.45 | Elsinore;W+GI+T | CA | n/a | 84 | NE | strike slip | 0 | 14 | 124 |
| 18.45 | Elsinore;W+GI | CA | n/a | 81 | NE | strike slip | 0 | 14 | 83 |
| 18.45 | Elsinore;GI | CA | 5 | 90 | V | strike slip | 0 | 13 | 37 |
| 18.45 | Elsinore;GI+T+J+CM | CA | n/a | 86 | NE | strike slip | 0 | 16 | 195 |
| 20.12 | Elsinore;T+J+CM | CA | n/a | 85 | NE | strike slip | 0 | 16 | 169 |
| 20.12 | Elsinore;T | CA | 5 | 90 | V | strike slip | 0 | 14 | 52 |
| 20.12 | Elsinore;T+J | CA | n/a | 86 | NE | strike slip | 0 | 17 | 127 |

| | | | | | | | | | |
|-------|--|----|-----|----|----|-------------|-----|----|-----|
| 21.47 | Chino, alt 2 | CA | 1 | 65 | SW | strike slip | 0 | 14 | 29 |
| 22.43 | Cucamonga | CA | 5 | 45 | N | thrust | 0 | 8 | 28 |
| 22.72 | Elsinore;W | CA | 2.5 | 75 | NE | strike slip | 0 | 14 | 46 |
| 22.73 | Chino, alt 1 | CA | 1 | 50 | SW | strike slip | 0 | 9 | 24 |
| 23.58 | S. San Andreas;BG+CO | CA | n/a | 72 | | strike slip | 0.3 | 12 | 125 |
| 23.58 | S. San Andreas;BG | CA | n/a | 58 | | strike slip | 0 | 13 | 56 |
| 24.70 | Cleghorn | CA | 3 | 90 | V | strike slip | 0 | 16 | 25 |
| 27.69 | North Frontal (West) | CA | 1 | 49 | S | reverse | 0 | 16 | 50 |
| 29.63 | Pinto Mtn | CA | 2.5 | 90 | V | strike slip | 0 | 16 | 74 |
| 30.69 | San Jose | CA | 0.5 | 74 | NW | strike slip | 0 | 15 | 20 |
| 33.55 | Sierra Madre | CA | 2 | 53 | N | reverse | 0 | 14 | 57 |
| 33.55 | Sierra Madre Connected | CA | 2 | 51 | | reverse | 0 | 14 | 76 |
| 33.63 | S. San Andreas;NM+SM | CA | n/a | 90 | V | strike slip | 0 | 14 | 134 |
| 33.63 | S. San Andreas;SM | CA | 29 | 90 | V | strike slip | 0 | 13 | 98 |
| 33.63 | S. San Andreas;BB+NM+SM | CA | n/a | 90 | V | strike slip | 0 | 14 | 184 |
| 33.63 | S. San Andreas;CH+CC+BB+NM+SM | CA | n/a | 90 | V | strike slip | 0 | 14 | 306 |
| 33.63 | S. San Andreas;CC+BB+NM+SM | CA | n/a | 90 | V | strike slip | 0 | 14 | 243 |
| 33.63 | S. San Andreas;PK+CH+CC+BB+NM+SM | CA | n/a | 90 | V | strike slip | 0.1 | 13 | 342 |
| 34.71 | San Joaquin Hills | CA | 0.5 | 23 | SW | thrust | 2 | 13 | 27 |
| 36.01 | Helendale-So Lockhart | CA | 0.6 | 90 | V | strike slip | 0 | 13 | 114 |
| 37.21 | North Frontal (East) | CA | 0.5 | 41 | S | thrust | 0 | 16 | 27 |
| 37.82 | Puente Hills (Coyote Hills) | CA | 0.7 | 26 | N | thrust | 2.8 | 15 | 17 |
| 41.46 | Elsinore;J | CA | 3 | 84 | NE | strike slip | 0 | 19 | 75 |
| 41.46 | Elsinore;J+CM | CA | 3 | 84 | NE | strike | 0 | 17 | 118 |

| | | | | | | | | | |
|-------|--|----|-----|----|----|-------------|-----|----|-----|
| | | | | | | slip | | | |
| 42.70 | Clamshell-Sawpit | CA | 0.5 | 50 | NW | reverse | 0 | 14 | 16 |
| 44.04 | Lenwood-Lockhart-Old Woman Springs | CA | 0.9 | 90 | V | strike slip | 0 | 13 | 145 |
| 44.16 | Newport-Inglewood (Offshore) | CA | 1.5 | 90 | V | strike slip | 0 | 10 | 66 |
| 44.16 | Newport Inglewood Connected alt 1 | CA | 1.3 | 89 | | strike slip | 0 | 11 | 208 |
| 44.16 | Newport Inglewood Connected alt 2 | CA | 1.3 | 90 | V | strike slip | 0 | 11 | 208 |
| 46.44 | Puente Hills (Santa Fe Springs) | CA | 0.7 | 29 | N | thrust | 2.8 | 15 | 11 |
| 46.71 | Newport-Inglewood, alt 1 | CA | 1 | 88 | | strike slip | 0 | 15 | 65 |
| 46.80 | Burnt Mtn | CA | 0.6 | 67 | W | strike slip | 0 | 16 | 21 |
| 47.85 | Raymond | CA | 1.5 | 79 | N | strike slip | 0 | 16 | 22 |
| 48.30 | Landers | CA | 0.6 | 90 | V | strike slip | 0 | 15 | 95 |
| 48.85 | Eureka Peak | CA | 0.6 | 90 | V | strike slip | 0 | 15 | 19 |
| 49.34 | San Jacinto;CC+B | CA | n/a | 90 | V | strike slip | 0.2 | 14 | 77 |
| 49.34 | San Jacinto;CC | CA | 4 | 90 | V | strike slip | 0 | 16 | 43 |
| 49.34 | San Jacinto;CC+B+SM | CA | n/a | 90 | V | strike slip | 0.2 | 14 | 103 |
| 49.82 | San Jacinto;C | CA | 14 | 90 | V | strike slip | 0 | 17 | 47 |
| 50.28 | Johnson Valley (No) | CA | 0.6 | 90 | V | strike slip | 0 | 16 | 35 |
| 52.14 | Elysian Park (Upper) | CA | 1.3 | 50 | NE | reverse | 3 | 15 | 20 |
| 52.75 | Puente Hills (LA) | CA | 0.7 | 27 | N | thrust | 2.1 | 15 | 22 |
| 56.12 | Verdugo | CA | 0.5 | 55 | NE | reverse | 0 | 15 | 29 |
| 56.12 | S. San Andreas;CO | CA | 20 | 90 | V | strike slip | 0.6 | 11 | 69 |
| 56.21 | Rose Canyon | CA | 1.5 | 90 | V | strike slip | 0 | 8 | 70 |
| 56.61 | So Emerson-Copper Mtn | CA | 0.6 | 90 | V | strike slip | 0 | 14 | 54 |
| 58.34 | Palos Verdes Connected | CA | 3 | 90 | V | strike | 0 | 10 | 285 |

| | | | | | | slip | | | |
|-------|--|----|-----|----|----|-------------|-----|----|-----|
| 58.34 | Palos Verdes | CA | 3 | 90 | V | strike slip | 0 | 14 | 99 |
| 60.00 | Coronado Bank | CA | 3 | 90 | V | strike slip | 0 | 9 | 186 |
| 60.18 | Hollywood | CA | 1 | 70 | N | strike slip | 0 | 17 | 17 |
| 62.06 | Calico-Hidalgo | CA | 1.8 | 90 | V | strike slip | 0 | 14 | 117 |
| 62.30 | Earthquake Valley | CA | 2 | 90 | V | strike slip | 0 | 19 | 20 |
| 63.05 | Santa Monica Connected alt 2 | CA | 2.4 | 44 | | strike slip | 0.8 | 11 | 93 |
| 66.77 | Pisgah-Bullion Mtn-Mesquite Lk | CA | 0.8 | 90 | V | strike slip | 0 | 13 | 88 |
| 67.00 | Sierra Madre (San Fernando) | CA | 2 | 45 | N | thrust | 0 | 13 | 18 |
| 67.26 | San Gabriel | CA | 1 | 61 | N | strike slip | 0 | 15 | 71 |
| 67.84 | Gravel Hills-Harper Lk | CA | 0.7 | 90 | V | strike slip | 0 | 11 | 65 |
| 69.79 | Santa Monica, alt 1 | CA | 1 | 75 | N | strike slip | 0 | 18 | 14 |
| 69.79 | Santa Monica Connected alt 1 | CA | 2.6 | 51 | | strike slip | 0 | 16 | 79 |
| 72.21 | Northridge | CA | 1.5 | 35 | S | thrust | 7.4 | 17 | 33 |
| 75.91 | Malibu Coast, alt 1 | CA | 0.3 | 75 | N | strike slip | 0 | 8 | 38 |
| 75.91 | Malibu Coast, alt 2 | CA | 0.3 | 74 | N | strike slip | 0 | 16 | 38 |
| 75.93 | San Jacinto:B | CA | 4 | 90 | V | strike slip | 0.7 | 13 | 34 |
| 75.93 | San Jacinto:B+SM | CA | n/a | 90 | V | strike slip | 0.4 | 12 | 61 |
| 76.18 | Blackwater | CA | 0.5 | 90 | V | strike slip | 0 | 12 | 60 |
| 77.41 | Anacapa-Dume, alt 2 | CA | 3 | 41 | N | thrust | 1.2 | 12 | 65 |
| 78.84 | Santa Susana, alt 1 | CA | 5 | 55 | N | reverse | 0 | 16 | 27 |
| 82.29 | Elsinore;CM | CA | 3 | 82 | NE | strike slip | 0 | 13 | 39 |
| 84.05 | Holser, alt 1 | CA | 0.4 | 58 | S | reverse | 0 | 19 | 20 |
| 85.43 | Anacapa-Dume, alt 1 | CA | 3 | 45 | N | thrust | 0 | 16 | 51 |

| | | | | | | | | | |
|-------|---|----|-----|----|---|-------------|-----|----|-----|
| 89.26 | Simi-Santa Rosa | CA | 1 | 60 | | strike slip | 1 | 12 | 39 |
| 91.73 | S. San Andreas;BB+NM | CA | n/a | 90 | V | strike slip | 0 | 15 | 87 |
| 91.73 | S. San Andreas;NM | CA | 27 | 90 | V | strike slip | 0 | 15 | 37 |
| 91.73 | S. San Andreas;CH+CC+BB+NM | CA | n/a | 90 | V | strike slip | 0 | 14 | 208 |
| 91.73 | S. San Andreas;PK+CH+CC+BB+NM | CA | n/a | 90 | V | strike slip | 0.1 | 12 | 245 |
| 91.73 | S. San Andreas;CC+BB+NM | CA | n/a | 90 | V | strike slip | 0 | 15 | 146 |
| 92.78 | Oak Ridge (Onshore) | CA | 4 | 65 | S | reverse | 1 | 19 | 49 |
| 92.78 | Oak Ridge Connected | CA | 3.6 | 53 | | reverse | 0.6 | 15 | 94 |
| 95.82 | San Cayetano | CA | 6 | 42 | N | thrust | 0 | 16 | 42 |
| 96.69 | San Jacinto;SM | CA | n/a | 90 | V | strike slip | 0 | 12 | 26 |
| 97.34 | Superstition Hills | CA | 4 | 90 | V | strike slip | 0.6 | 12 | 36 |
| 99.38 | Elmore Ranch | CA | 1 | 90 | V | strike slip | 0 | 11 | 29 |



Search Results

12 of 12 earthquakes in map area.

Click for more information


| | | |
|------------|--|---------|
| 6.3 | 7km SSE of Big Bear City, CA 1992-06-28 15:05:30 (UTC) | 3.6 km |
| 7.3 | Landers, California Earthquake 1992-06-28 11:57:34 (UTC) | -0.1 km |
| 6.1 | 17km NNE of Thousand Palms, California 1992-04-23 04:50:23 (UTC) | 11.6 km |
| 6.0 | 6km SSW of Morongo Valley, CA 1986-07-08 09:20:44 (UTC) | 9.5 km |
| 6.0 | 16km E of Desert Hot Springs, CA 1948-12-04 23:43:16 (UTC) | 6.0 km |
| 6.4 | Long Beach, California Earthquake 1933-03-11 01:54:09 (UTC) | 6.0 km |
| 6.8 | Southern California 1918-04-21 22:32:25 (UTC) | - |
| 6.8 | Southern California 1899-12-25 12:25:00 (UTC) | - |
| 6.4 | Southern California 1899-07-22 20:32:00 (UTC) | - |
| 6.0 | Near San Bernardino, California 1858-12-16 10:00:00 (UTC) | - |
| 6.0 | Greater Los Angeles area, California 1855-07-11 04:15:00 (UTC) | - |
| 6.9 | Southern California 1812-12-08 15:00:00 (UTC) | - |

Didn't find what you were looking for?

- Check your [Settings](#).
- [Which earthquakes are included on the map and list?](#)
- [Felt something not shown - report it here.](#)



Latitude, Longitude: 33.918369, -117.210555

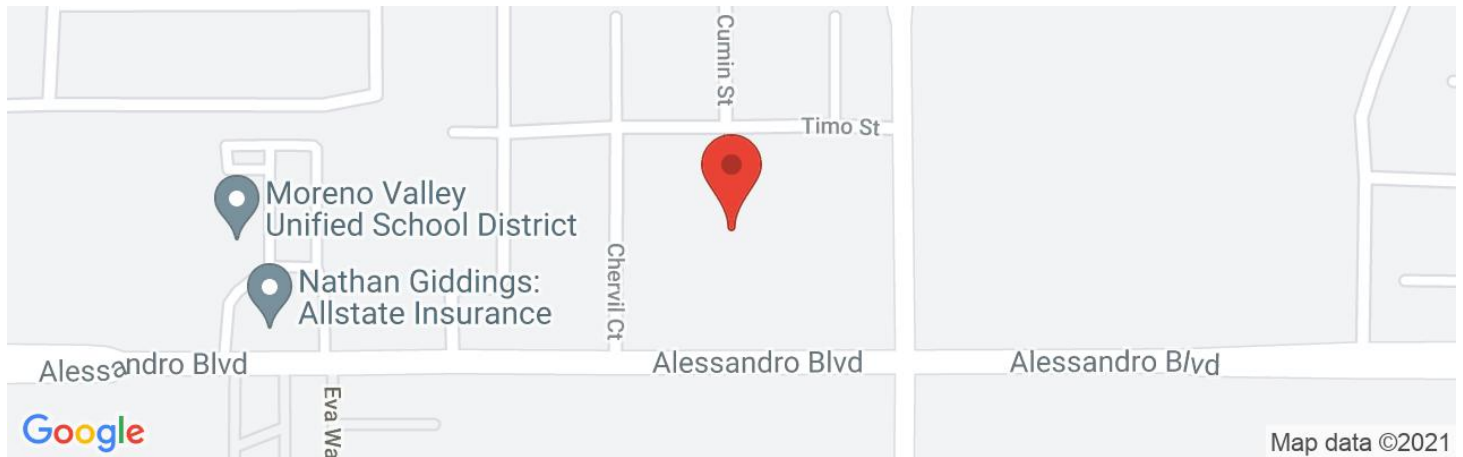

| | |
|---------------------------------------|----------------------------------|
| Date | 9/8/2021, 7:43:35 AM |
| Design Code Reference Document | ASCE7-16 |
| Risk Category | II |
| Site Class | D - Default (See Section 11.4.3) |

| Type | Value | Description |
|----------|--------------------------|--|
| S_S | 1.728 | MCE_R ground motion. (for 0.2 second period) |
| S_1 | 0.675 | MCE_R ground motion. (for 1.0s period) |
| S_{MS} | 2.074 | Site-modified spectral acceleration value |
| S_{M1} | null -See Section 11.4.8 | Site-modified spectral acceleration value |
| S_{DS} | 1.382 | Numeric seismic design value at 0.2 second SA |
| S_{D1} | null -See Section 11.4.8 | Numeric seismic design value at 1.0 second SA |

| Type | Value | Description |
|-----------|--------------------------|---|
| SDC | null -See Section 11.4.8 | Seismic design category |
| F_a | 1.2 | Site amplification factor at 0.2 second |
| F_v | null -See Section 11.4.8 | Site amplification factor at 1.0 second |
| PGA | 0.731 | MCE_G peak ground acceleration |
| F_{PGA} | 1.2 | Site amplification factor at PGA |
| PGA_M | 0.877 | Site modified peak ground acceleration |
| T_L | 8 | Long-period transition period in seconds |
| S_{sRT} | 1.889 | Probabilistic risk-targeted ground motion. (0.2 second) |
| S_{sUH} | 2.061 | Factored uniform-hazard (2% probability of exceedance in 50 years) spectral acceleration |
| S_{sD} | 1.728 | Factored deterministic acceleration value. (0.2 second) |
| S_{1RT} | 0.737 | Probabilistic risk-targeted ground motion. (1.0 second) |
| S_{1UH} | 0.823 | Factored uniform-hazard (2% probability of exceedance in 50 years) spectral acceleration. |
| S_{1D} | 0.675 | Factored deterministic acceleration value. (1.0 second) |
| $PGAd$ | 0.731 | Factored deterministic acceleration value. (Peak Ground Acceleration) |
| C_{RS} | 0.916 | Mapped value of the risk coefficient at short periods |
| C_{R1} | 0.895 | Mapped value of the risk coefficient at a period of 1 s |

DISCLAIMER

While the information presented on this website is believed to be correct, SEAOC / OSHPD and its sponsors and contributors assume no responsibility or liability for its accuracy. The material presented in this web application should not be used or relied upon for any specific application without competent examination and verification of its accuracy, suitability and applicability by engineers or other licensed professionals. SEAOC / OSHPD do not intend that the use of this information replace the sound judgment of such competent professionals, having experience and knowledge in the field of practice, nor to substitute for the standard of care required of such professionals in interpreting and applying the results of the seismic data provided by this website. Users of the information from this website assume all liability arising from such use. Use of the output of this website does not imply approval by the governing building code bodies responsible for building code approval and interpretation for the building site described by latitude/longitude location in the search results of this website.

APPENDIX E

EARTHWORK AND GRADING SPECIFICATIONS

EARTH-STRATA

General Earthwork and Grading Specifications

General

Intent: These General Earthwork and Grading Specifications are intended to be the minimum requirements for the grading and earthwork shown on the approved grading plan(s) and/or indicated in the geotechnical report(s). These General Earthwork and Grading Specifications should be considered a part of the recommendations contained in the geotechnical report(s) and if they are in conflict with the geotechnical report(s), the specific recommendations in the geotechnical report shall supersede these more general specifications. Observations made during earthwork operations by the project Geotechnical Consultant may result in new or revised recommendations that may supersede these specifications and/or the recommendations in the geotechnical report(s).

The Geotechnical Consultant of Record: The Owner shall employ a qualified Geotechnical Consultant of Record (Geotechnical Consultant), prior to commencement of grading or construction. The Geotechnical Consultant shall be responsible for reviewing the approved geotechnical report(s) and accepting the adequacy of the preliminary geotechnical findings, conclusions, and recommendations prior to the commencement of the grading or construction.

Prior to commencement of grading or construction, the Owner shall coordinate with the Geotechnical Consultant, and Earthwork Contractor (Contractor) to schedule sufficient personnel for the appropriate level of observation, mapping, and compaction testing.

During earthwork and grading operations, the Geotechnical Consultant shall observe, map, and document the subsurface conditions to confirm assumptions made during the geotechnical design phase of the project. Should the observed conditions differ significantly from the interpretive assumptions made during the design phase, the Geotechnical Consultant shall recommend appropriate changes to accommodate the observed conditions, and notify the reviewing agency where required.

The Geotechnical Consultant shall observe the moisture conditioning and processing of the excavations and fill materials. The Geotechnical Consultant should perform periodic relative density testing of fill materials to verify that the attained level of compaction is being accomplished as specified.

The Earthwork Contractor: The Earthwork Contractor (Contractor) shall be qualified, experienced, and knowledgeable in earthwork logistics, preparation and processing of earth materials to receive compacted fill, moisture-conditioning and processing of fill, and compacting fill. The Contractor shall be provided with the approved grading plans and geotechnical report(s) for his review and acceptance of responsibilities, prior to commencement of grading. The Contractor shall be solely responsible for performing the grading in accordance with the approved grading plans and geotechnical report(s). Prior to commencement of grading, the Contractor shall prepare and submit to the Owner and the Geotechnical Consultant a work plan that indicates the sequence of earthwork grading, the number of "equipment" of work and the estimated quantities of daily earthwork contemplated for the site. The Contractor shall inform the Owner and the Geotechnical Consultant of work schedule changes and revisions to the work plan at least 24 hours in advance of such changes so that appropriate personnel will be available for observation and testing. No assumptions shall be made by the Contractor with regard to whether the Geotechnical Consultant is aware of all grading operations.

It is the sole responsibility of the Contractor to provide adequate equipment and methods to accomplish the earthwork operations in accordance with the applicable grading codes and agency ordinances, these specifications, and the recommendations in the approved geotechnical report(s) and grading plan(s). At the sole discretion of the Geotechnical Consultant, any unsatisfactory conditions, such as unsuitable earth materials, improper moisture conditioning, inadequate compaction, insufficient buttress keyway size, adverse weather conditions, etc., resulting in a quality of work less than required in the approved grading plans and geotechnical report(s), the Geotechnical Consultant shall reject the work and may recommend to the Owner that grading be stopped until conditions are corrected.

Preparation of Areas for Compacted Fill

Clearing and Grubbing: Vegetation, such as brush, grass, roots, and other deleterious material shall be sufficiently removed and properly disposed in a method acceptable to the Owner, Geotechnical Consultant, and governing agencies.

The Geotechnical Consultant shall evaluate the extent of these removals on a site by site basis. Earth materials to be placed as compacted fill shall not contain more than 1 percent organic materials (by volume). No compacted fill lift shall contain more than 10 percent organic matter.

Should potentially hazardous materials be encountered, the Contractor shall stop work in the affected area, and a hazardous materials specialist shall immediately be consulted to evaluate the potentially hazardous materials, prior to continuing to work in that area.

It is our understanding that the State of California defines most refined petroleum products (gasoline, diesel fuel, motor oil, grease, coolant, etc.) as hazardous waste. As such, indiscriminate dumping or spillage of these fluids may constitute a misdemeanor, punishable by fines and/or imprisonment, and shall be prohibited. The contractor is responsible for all hazardous waste related to his operations. The Geotechnical Consultant does not have expertise in this area. If hazardous waste is a concern, then the Owner should contract the services of a qualified environmental assessor.

Processing: Exposed earth materials that have been observed to be satisfactory for support of compacted fill by the Geotechnical Consultant shall be scarified to a minimum depth of 6 inches. Exposed earth materials that are not observed to be satisfactory shall be removed or alternative recommendations may be provided by the Geotechnical Consultant. Scarification shall continue until the exposed earth materials are broken down and free of oversize material and the working surface is reasonably uniform, flat, and free of uneven features that would inhibit uniform compaction. The earth materials should be moistened or air dried to near optimum moisture content, prior to compaction.

Overexcavation: The Cut Lot Typical Detail and Cut/Fill Transition Lot Typical Detail, included herein provides a graphic illustration that depicts typical overexcavation recommendations made in the approved geotechnical report(s) and/or grading plan(s).

Keyways and Benching: Where fills are to be placed on slopes steeper than 5:1 (horizontal to vertical units), the ground shall be thoroughly benched as compacted fill is placed. Please see the three Keyway and Benching Typical Details with subtitles Cut Over Fill Slope, Fill Over Cut Slope, and Fill Slope for a graphic illustration. The lowest bench or smallest keyway shall be a minimum of 10 feet wide (or ½ the proposed slope height) and at least 2 feet into competent earth materials as advised by the Geotechnical Consultant. Typical benches shall be excavated a minimum height of 4 feet into competent earth materials or as recommended by the Geotechnical Consultant. Fill placed on slopes steeper than 5:1 should be thoroughly benched or otherwise excavated to provide a flat subgrade for the compacted fill.

Evaluation/Acceptance of Bottom Excavations: All areas to receive compacted fill (bottom excavations), including removal excavations, processed areas, keyways, and benching, shall be observed, mapped, general elevations recorded, and/or tested prior to being accepted by the Geotechnical Consultant as suitable to receive compacted fill. The Contractor shall obtain a written acceptance from the Geotechnical Consultant prior to placing compacted fill. A licensed surveyor shall provide the survey control for determining elevations of bottom excavations, processed areas, keyways, and

benching. The Geotechnical Consultant is not responsible for erroneously located, fills, subdrain systems, or excavations.

Fill Materials

General: Earth material to be used as compacted fill should to a large extent be free of organic matter and other deleterious substances as evaluated and accepted by the Geotechnical Consultant.

Oversize: Oversize material is rock that does not break down into smaller pieces and has a maximum diameter greater than 12 inches. Oversize rock shall not be included within compacted fill unless specific methods and guidelines acceptable to the Geotechnical Consultant are followed. For examples of methods and guidelines of oversize rock placement see the enclosed Oversize Rock Disposal Detail. The inclusion of oversize materials in the compacted fill shall only be acceptable if the oversize material is completely surrounded by compacted fill or thoroughly jetted granular materials. No oversize material shall be placed within 10 vertical feet of finish grade or within 2 feet of proposed utilities or underground improvements.

Import: Should imported earth materials be required, the proposed import materials shall meet the requirements of the Geotechnical Consultant. Well graded, very low expansion potential earth materials free of organic matter and other deleterious substances are usually sought after as import materials. However, it is generally in the Owners best interest that potential import earth materials are provided to the Geotechnical Consultant to determine their suitability for the intended purpose. At least 48 hours should be allotted for the appropriate laboratory testing to be performed, prior to starting the import operations.

Fill Placement and Compaction Procedures

Fill Layers: Fill materials shall be placed in areas prepared to receive fill in nearly horizontal layers not exceeding 8 inches in loose thickness. Thicker layers may be accepted by the Geotechnical Consultant, provided field density testing indicates that the grading procedures can adequately compact the thicker layers. Each layer of fill shall be spread evenly and thoroughly mixed to obtain uniformity within the earth materials and consistent moisture throughout the fill.

Moisture Conditioning of Fill: Earth materials to be placed as compacted fill shall be watered, dried, blended, and/or mixed, as needed to obtain relatively uniform moisture contents that are at or slightly above optimum. The maximum density and optimum moisture content tests should be performed in accordance with the American Society of Testing and Materials (ASTM test method D1557-00).

Compaction of Fill: After each layer has been moisture-conditioned, mixed, and evenly spread, it should be uniformly compacted to a minimum of 90 percent of maximum dry density as determined by ASTM test method D1557-00. Compaction equipment shall be adequately sized and be either specifically designed for compaction of earth materials or be proven to consistently achieve the required level of compaction.

Compaction of Fill Slopes: In addition to normal compaction procedures specified above, additional effort to obtain compaction on slopes is needed. This may be accomplished by backrolling of slopes with sheepsfoot rollers as the fill is being placed, by overbuilding the fill slopes, or by other methods producing results that are satisfactory to the Geotechnical Consultant. Upon completion of grading, relative compaction of the fill and the slope face shall be a minimum of 90 percent of maximum density per ASTM test method D1557-00.

Compaction Testing of Fill: Field tests for moisture content and relative density of the compacted fill earth materials shall be periodically performed by the Geotechnical Consultant. The location and frequency of tests shall be at the Geotechnical Consultant's discretion based on field observations. Compaction test locations will not necessarily be random. The test locations may or may not be selected to verify minimum compaction requirements in areas that are typically prone to inadequate compaction, such as close to slope faces and near benching.

Frequency of Compaction Testing: Compaction tests shall be taken at minimum intervals of every 2 vertical feet and/or per 1,000 cubic yards of compacted materials placed. Additionally, as a guideline, at least one (1) test shall be taken on slope faces for each 5,000 square feet of slope face and/or for each 10 vertical feet of slope. The Contractor shall assure that fill placement is such that the testing schedule described herein can be accomplished by the Geotechnical Consultant. The Contractor shall stop or slow down the earthwork operations to a safe level so that these minimum standards can be obtained.

Compaction Test Locations: The approximate elevation and horizontal coordinates of each test location shall be documented by the Geotechnical Consultant. The Contractor shall coordinate with the Surveyor to assure that sufficient grade stakes are established. This will provide the Geotechnical Consultant with sufficient accuracy to determine the approximate test locations and elevations. The Geotechnical Consultant can not be responsible for staking erroneously located by the Surveyor or Contractor. A minimum of two grade stakes should be provided at a maximum horizontal distance of 100 feet and vertical difference of less than 5 feet.

Subdrain System Installation

Subdrain systems shall be installed in accordance with the approved geotechnical report(s), the approved grading plan, and the typical details provided herein. The Geotechnical Consultant may recommend additional subdrain systems and/or changes to the subdrain systems described herein, with regard to the extent, location, grade, or material depending on conditions encountered during grading or other factors. All subdrain systems shall be surveyed by a licensed land surveyor (except for retaining wall subdrain systems) to verify line and grade after installation and prior to burial. Adequate time should be allowed by the Contractor to complete these surveys.


Excavation

All excavations and over-excavations for remedial purposes shall be evaluated by the Geotechnical Consultant during grading operations. Remedial removal depths indicated on the geotechnical plans are estimates only. The actual removal depths and extent shall be determined by the Geotechnical Consultant based on the field evaluation of exposed conditions during grading operations. Where fill over cut slopes are planned, the cut portion of the slope shall be excavated, evaluated, and accepted by the Geotechnical Consultant prior to placement of the fill portion of the proposed slope, unless specifically addressed by the Geotechnical Consultant. Typical details for cut over fill slopes and fill over cut slopes are provided herein.



Trench Backfill

- 1) The Contractor shall follow all OSHA and Cal/OSHA requirements for trench excavation safety.
- 2) Bedding and backfill of utility trenches shall be done in accordance with the applicable provisions in the Standard Specifications of Public Works Construction. Bedding materials shall have a Sand Equivalency more than 30 (SE>30). The bedding shall be placed to 1 foot over the conduit and thoroughly jetting to provide densification. Backfill should be compacted to a minimum of 90 percent of maximum dry density, from 1 foot above the top of the conduit to the surface.
- 3) Jetting of the bedding materials around the conduits shall be observed by the Geotechnical Consultant.
- 4) The Geotechnical Consultant shall test trench backfill for the minimum compaction requirements recommended herein. At least one test should be conducted for every 300 linear feet of trench and for each 2 vertical feet of backfill.
- 5) For trench backfill the lift thicknesses shall not exceed those allowed in the Standard Specifications of Public Works Construction, unless the Contractor can demonstrate to the Geotechnical Consultant that the fill lift can be compacted to the minimum relative compaction by his alternative equipment or method.


STABILIZATION FILL TYPICAL DETAIL

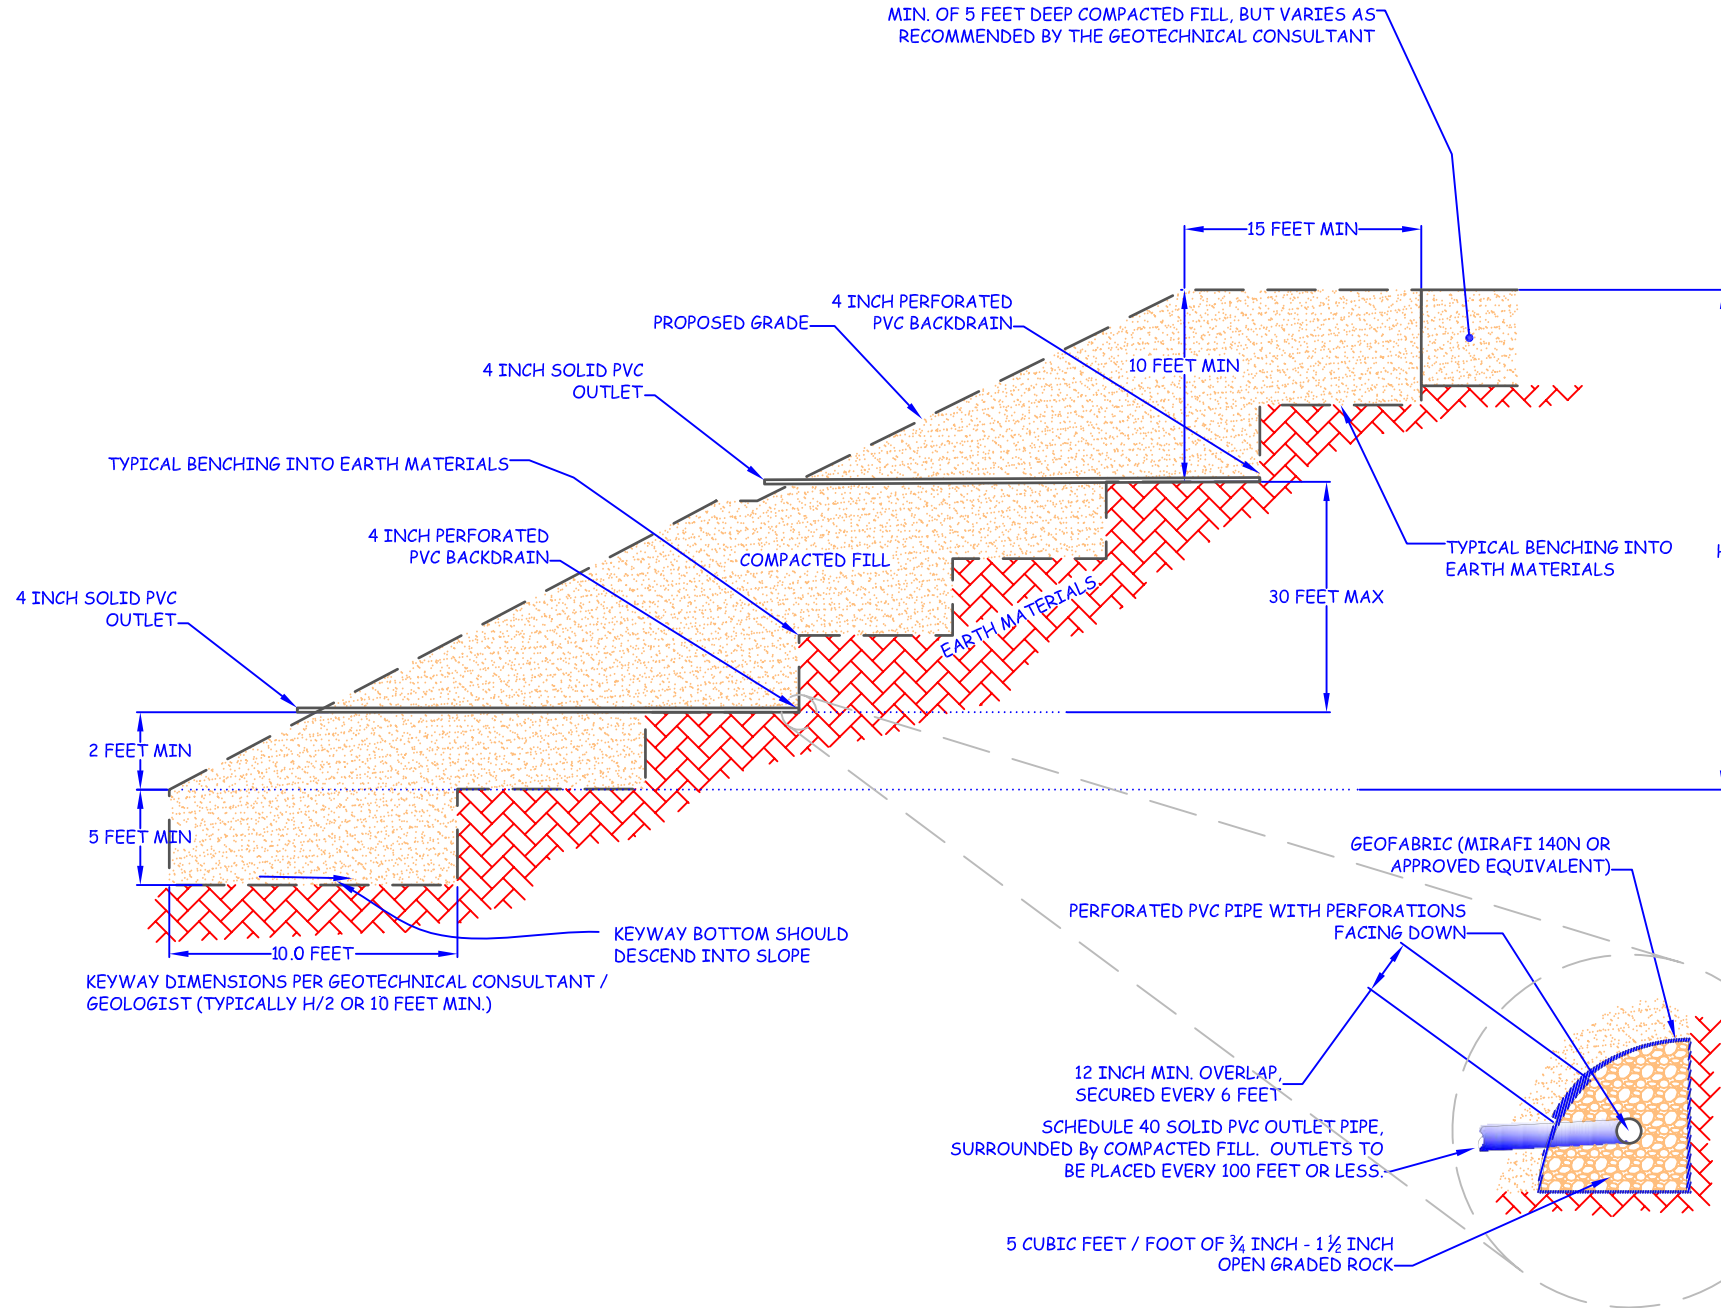

BUTTRESS TYPICAL DETAIL

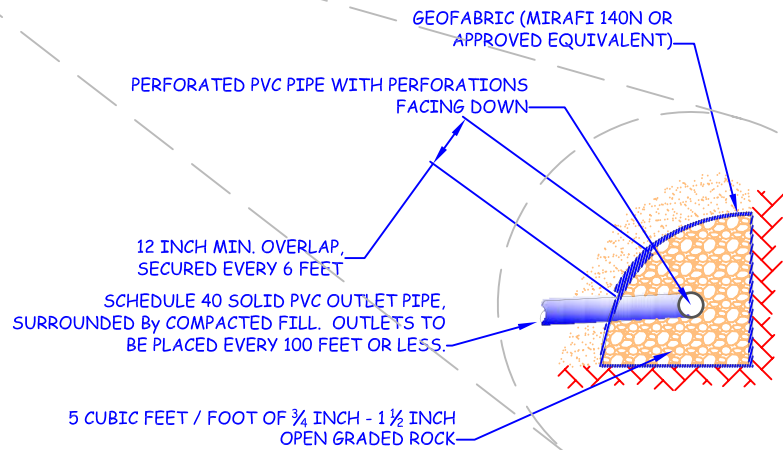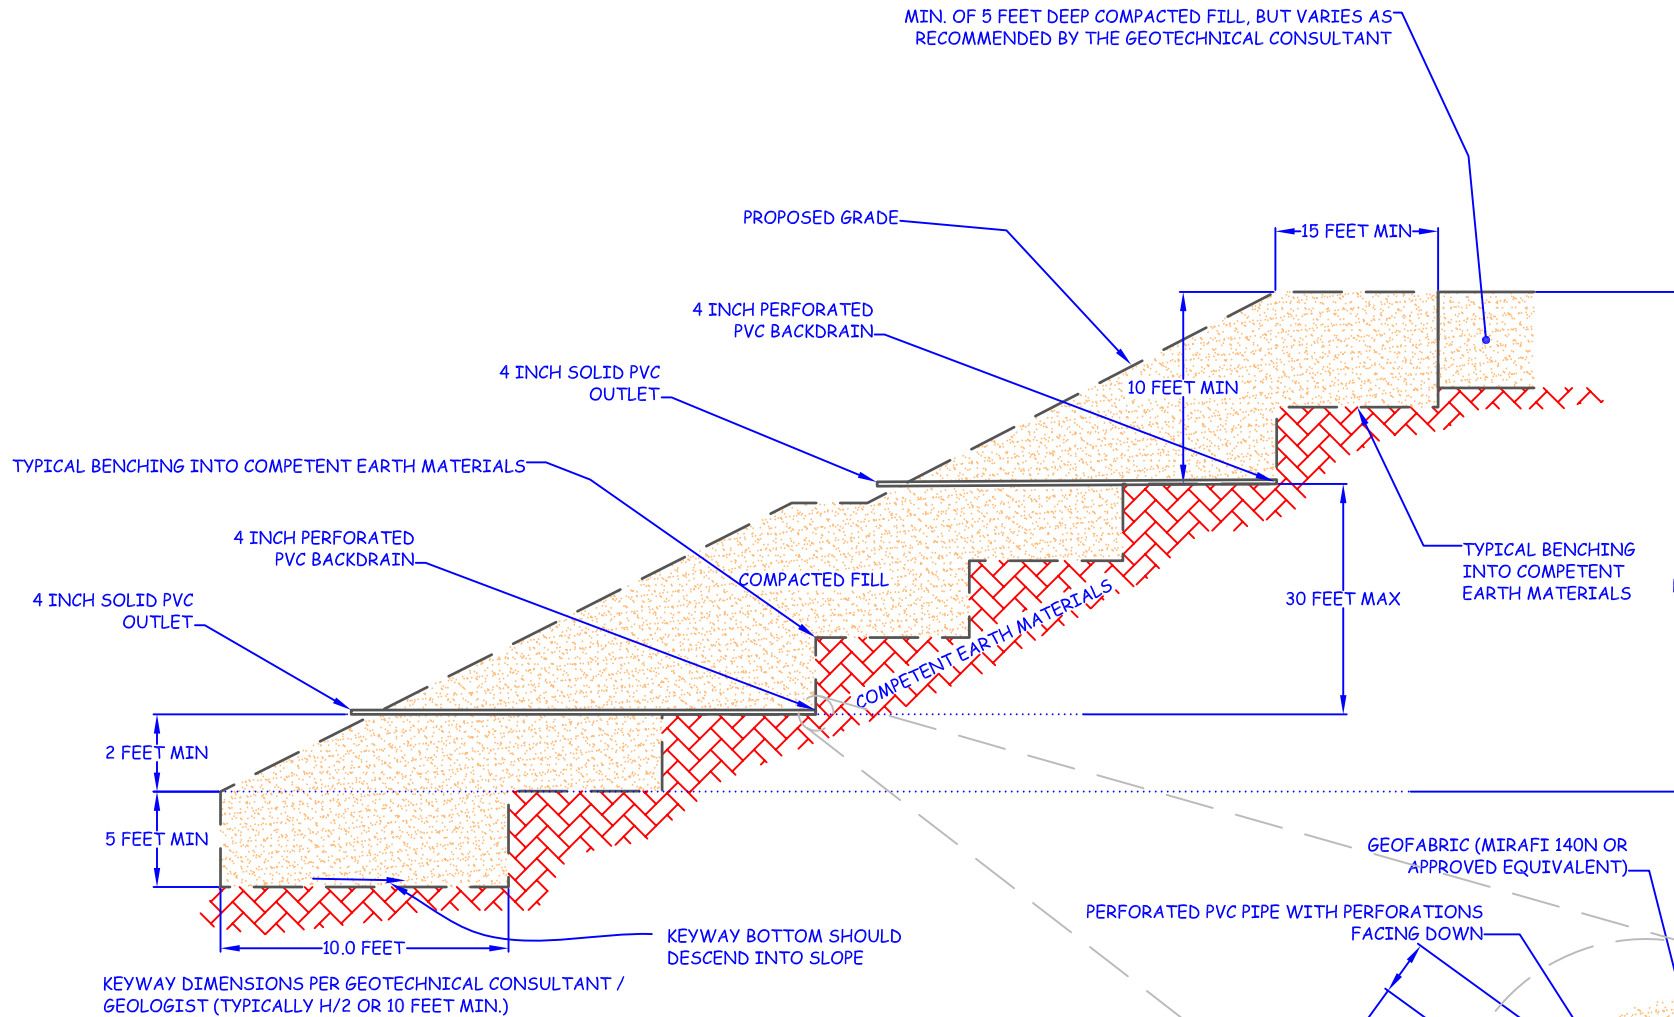


CANYON SUBDRAIN SYSTEM TYPICAL DETAIL

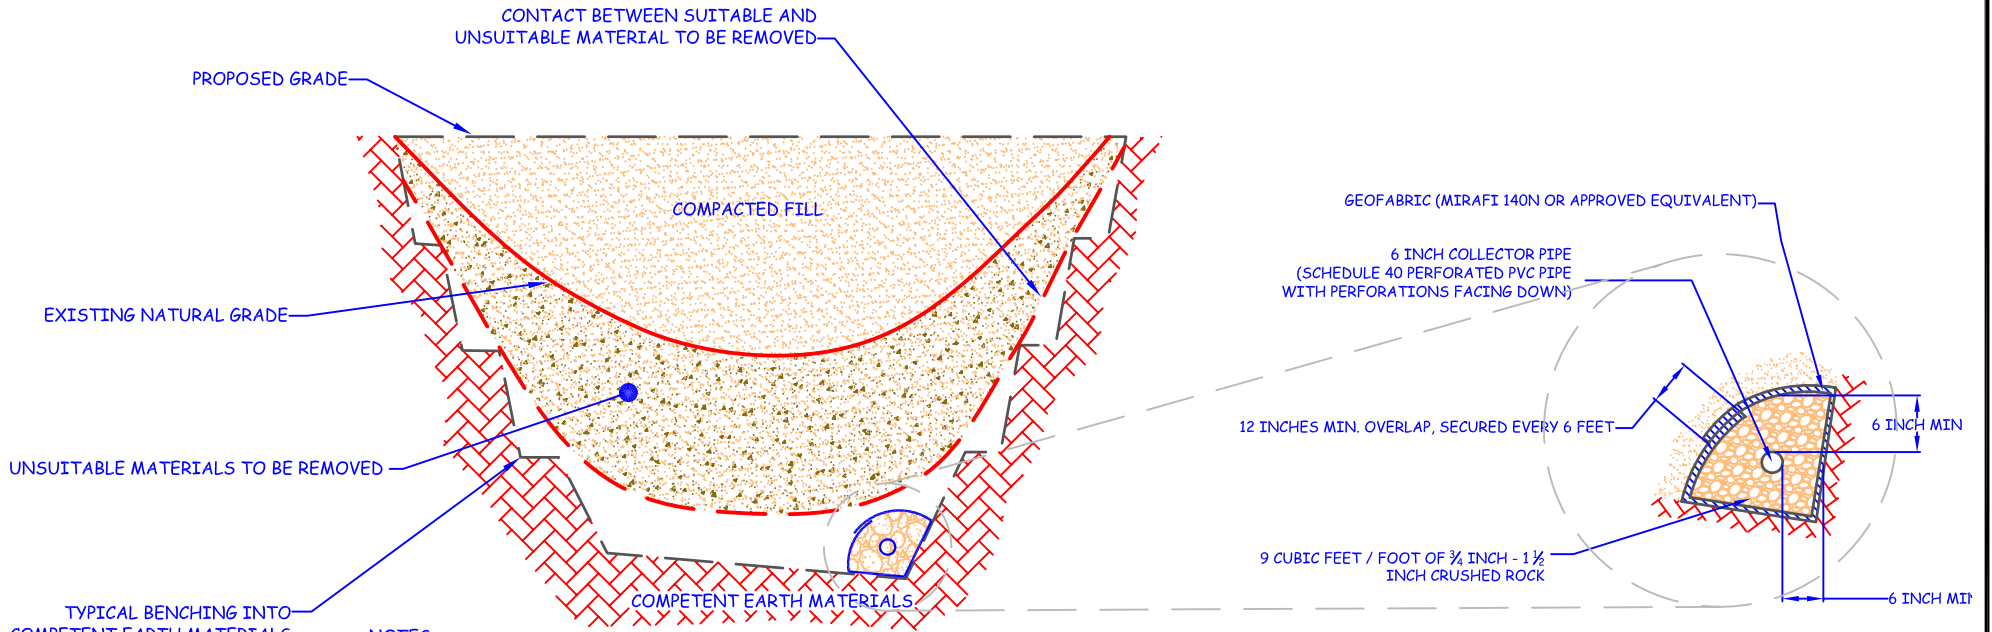


- NOTES:**
- 1 - CONTINUOUS RUNS IN EXCESS OF 500 FEET LONG WILL REQUIRE AN 8 INCH DIAMETER PIPE.
 - 2 - FINAL 20 FEET OF PIPE AT OUTLET WILL BE SOLID AND BACKFILLED WITH COMPACTED FINE-GRAINED EARTH MATERIALS.

CANYON SUBDRAIN TYPICAL OUTLET

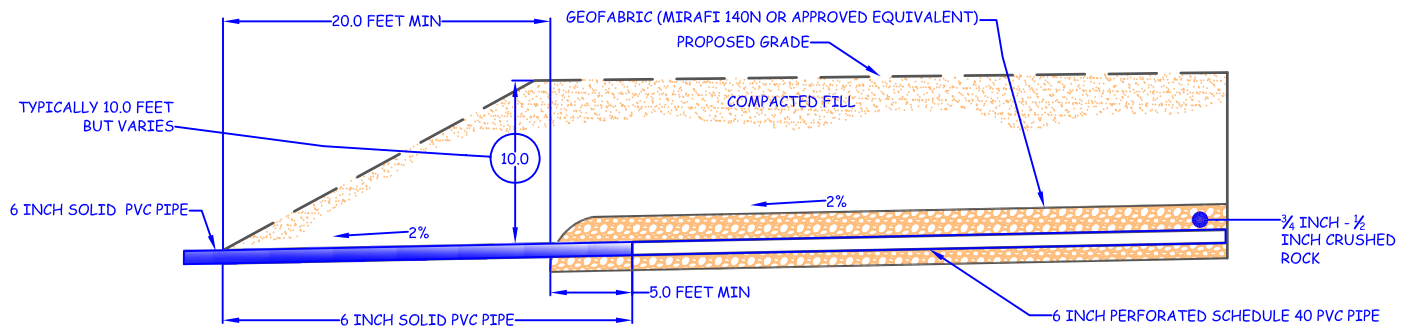


CUT LOT TYPICAL DETAIL

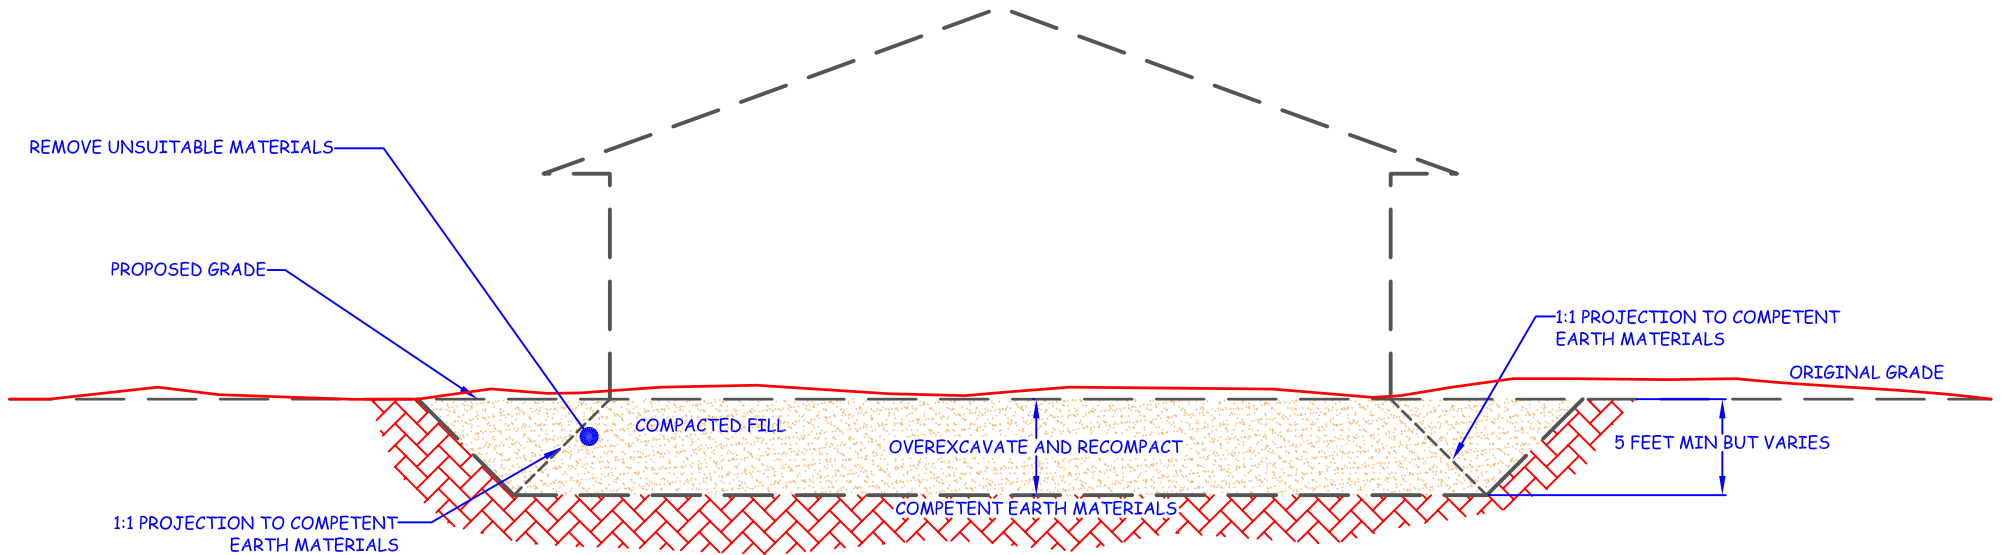

NOTE: REMOVAL BOTTOMS SHOULD BE GRADED WITH A MINIMUM 2% FALL TOWARDS STREET OR OTHER SUITABLE AREA (AS DETERMINED BY THE GEOTECHNICAL CONSULTANT) TO AVOID PONDING BELOW THE BUILDING

NOTE: WHERE DESIGN CUT LOTS ARE EXCAVATED ENTIRELY INTO COMPETENT EARTH MATERIALS, OVEREXCAVATION MAY STILL BE NEEDED FOR HARD-ROCK CONDITIONS OR MATERIALS WITH VARIABLE EXPANSION POTENTIALS


CUT / FILL TRANSITION LOT TYPICAL DETAIL

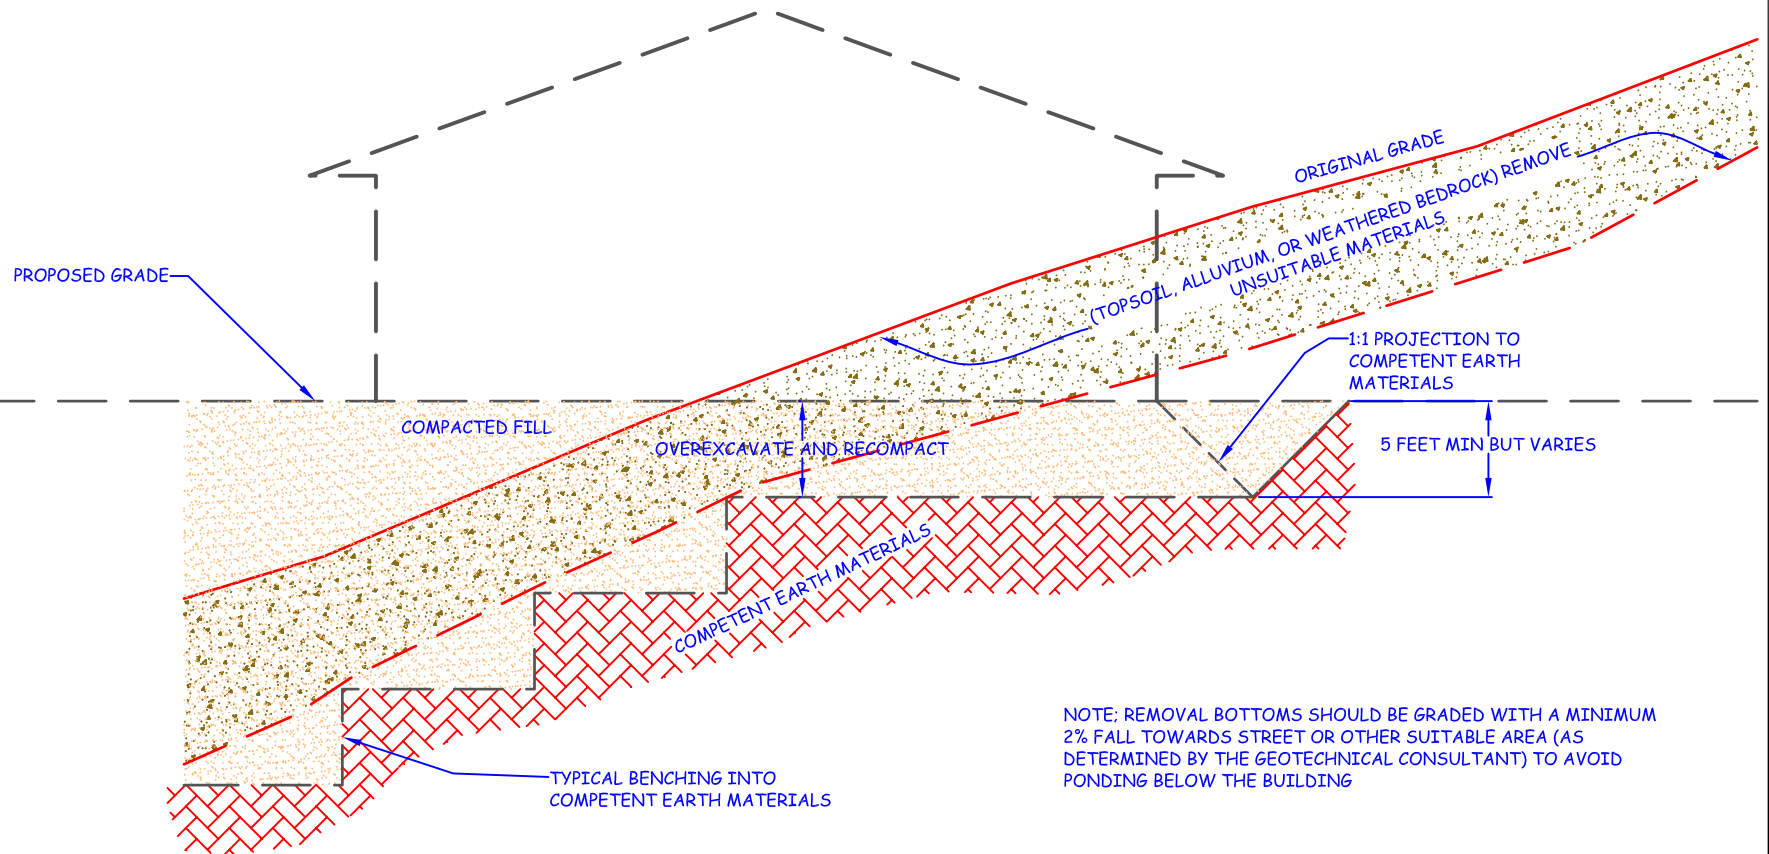

NOTE: REMOVAL BOTTOMS SHOULD BE GRADED WITH A MINIMUM 2% FALL TOWARDS STREET OR OTHER SUITABLE AREA (AS DETERMINED BY THE GEOTECHNICAL CONSULTANT) TO AVOID PONDING BELOW THE BUILDING

NOTE: WHERE DESIGN CUT LOTS ARE EXCAVATED ENTIRELY INTO COMPETENT EARTH MATERIALS, OVEREXCAVATION MAY STILL BE NEEDED FOR HARD-ROCK CONDITIONS OR MATERIALS WITH VARIABLE EXPANSION POTENTIALS


KEYWAY & BENCHING TYPICAL DETAILS CUT OVER FILL SLOPE

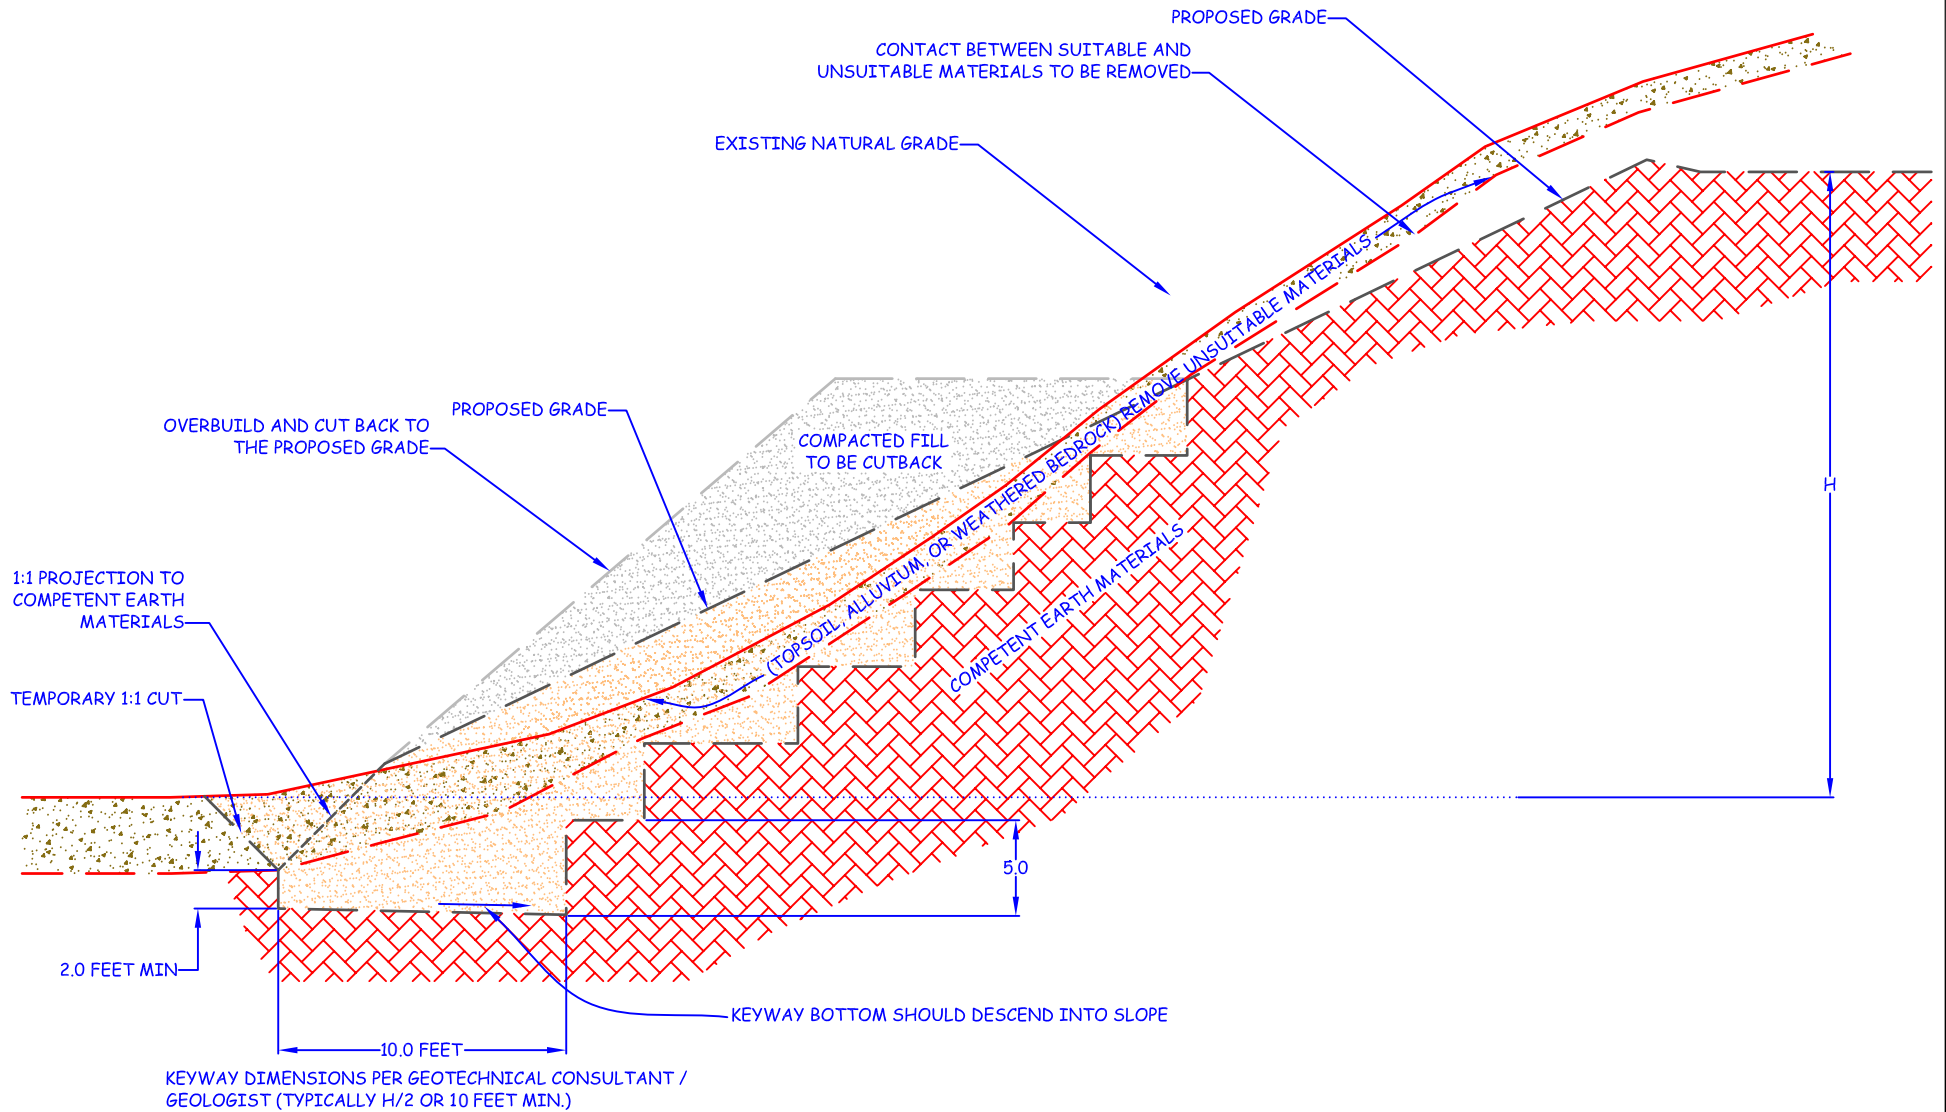

NOTE:

NATURAL SLOPES STEEPER THAN 5:1 (H:V) MUST BE BENCHING INTO COMPETENT EARTH MATERIALS

KEYWAY & BENCHING TYPICAL DETAILS FILL OVER CUT SLOPE

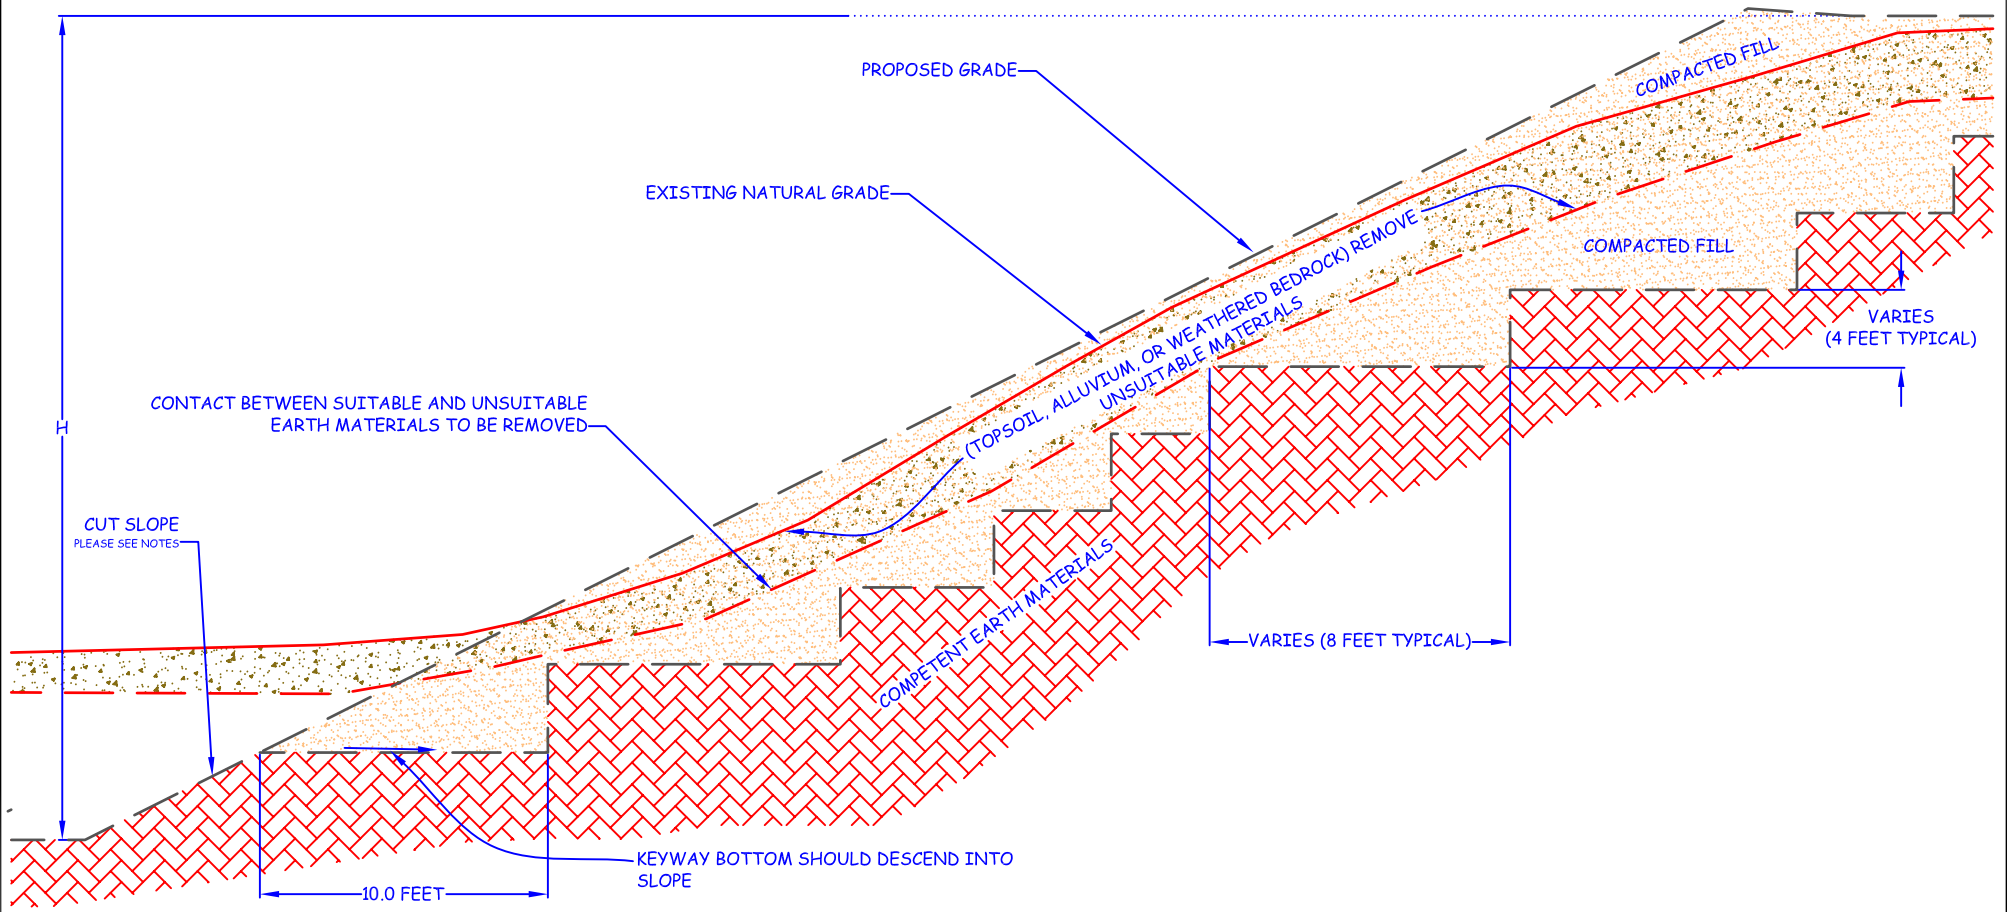


NOTES:

NATURAL SLOPES STEEPER THAN 5:1 (H:V) MUST BE BENCHED INTO COMPETENT EARTH MATERIALS

THE CUT SLOPE MUST BE CONSTRUCTED FIRST


KEYWAY & BENCHING TYPICAL DETAILS FILL SLOPE

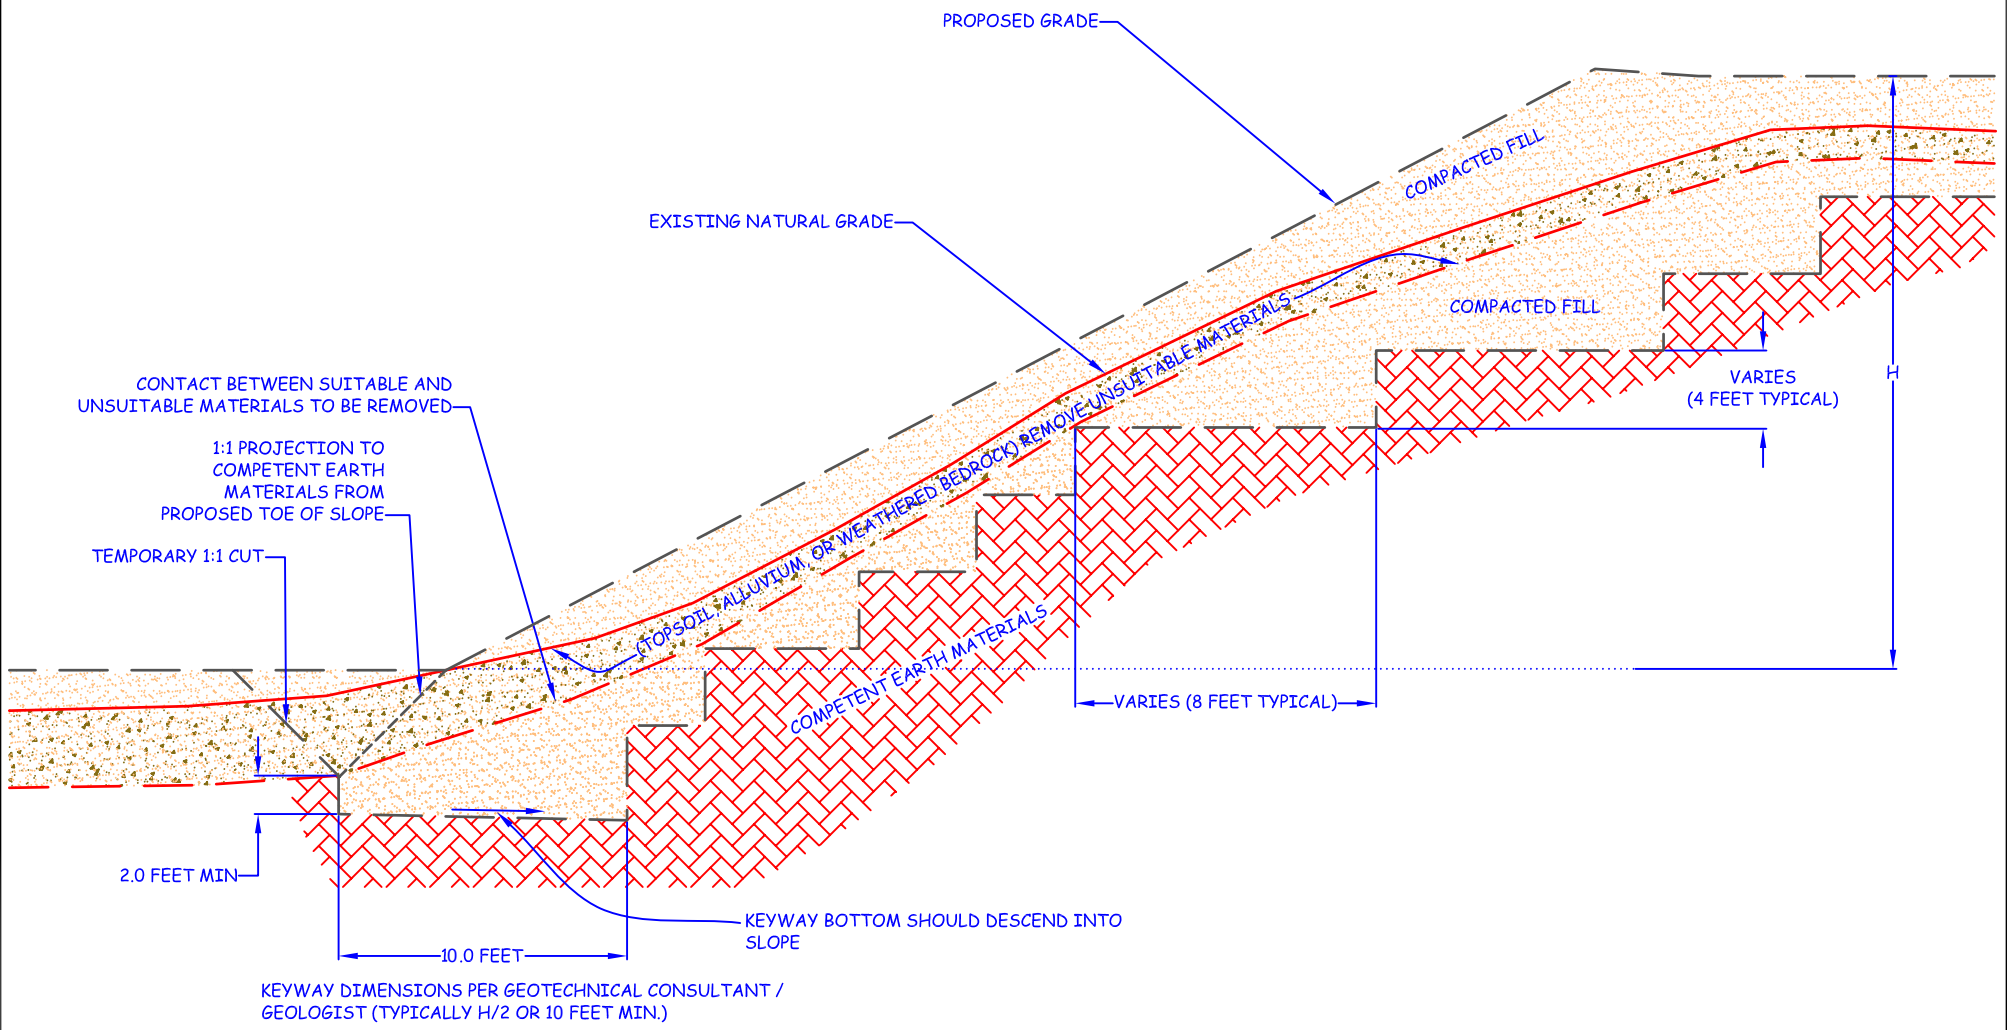

NOTES:

NATURAL SLOPES STEEPER THAN 5:1 (H:V) MUST BE BENCHING INTO COMPETENT EARTH MATERIALS


OVERSIZE ROCK TYPICAL DETAIL

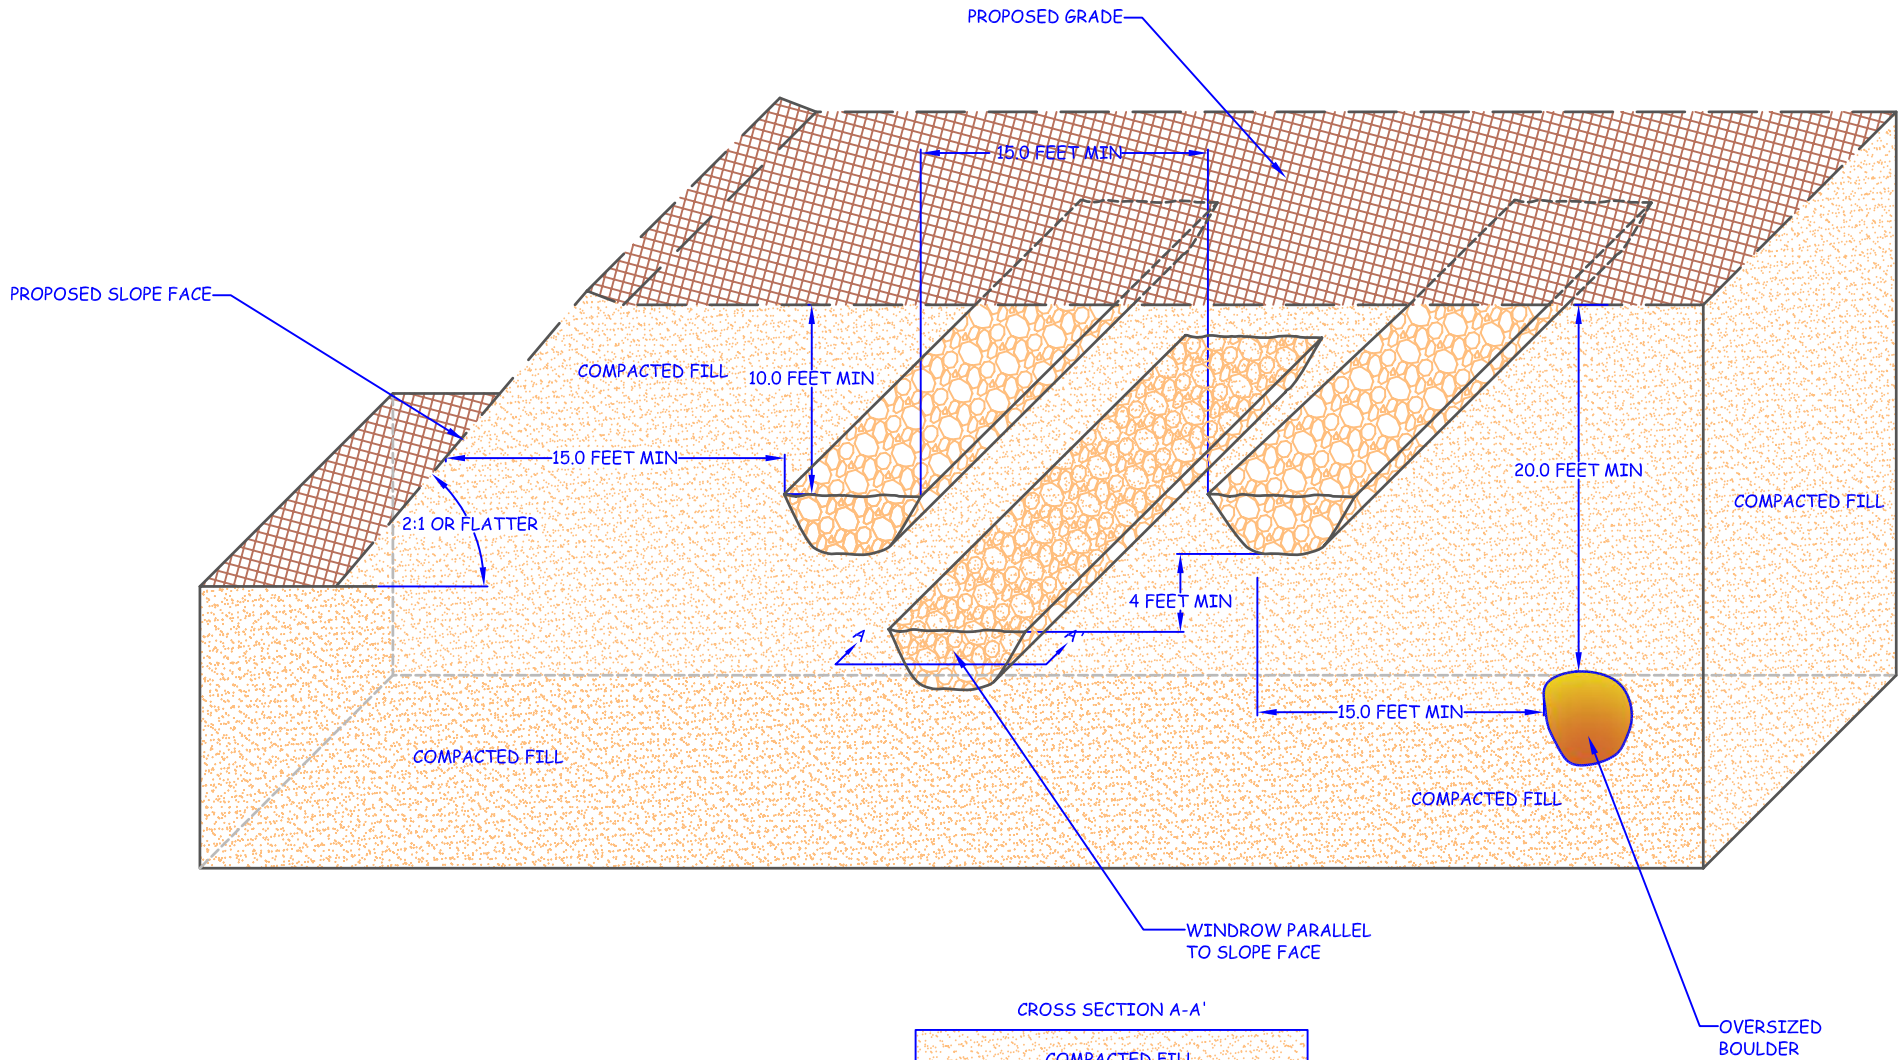

CROSS SECTION A-A'


JETTING OF APPROVED GRANULAR MATERIAL

EXCAVATED TRENCH OR DOZER V-CUT

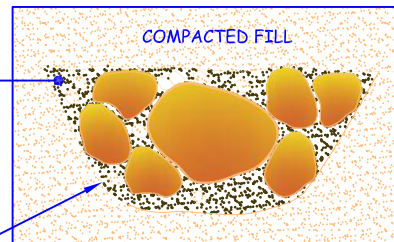

NOTES:

OVERSIZE ROCK IS LARGER THAN 8 INCHES IN MAX DIAMETER

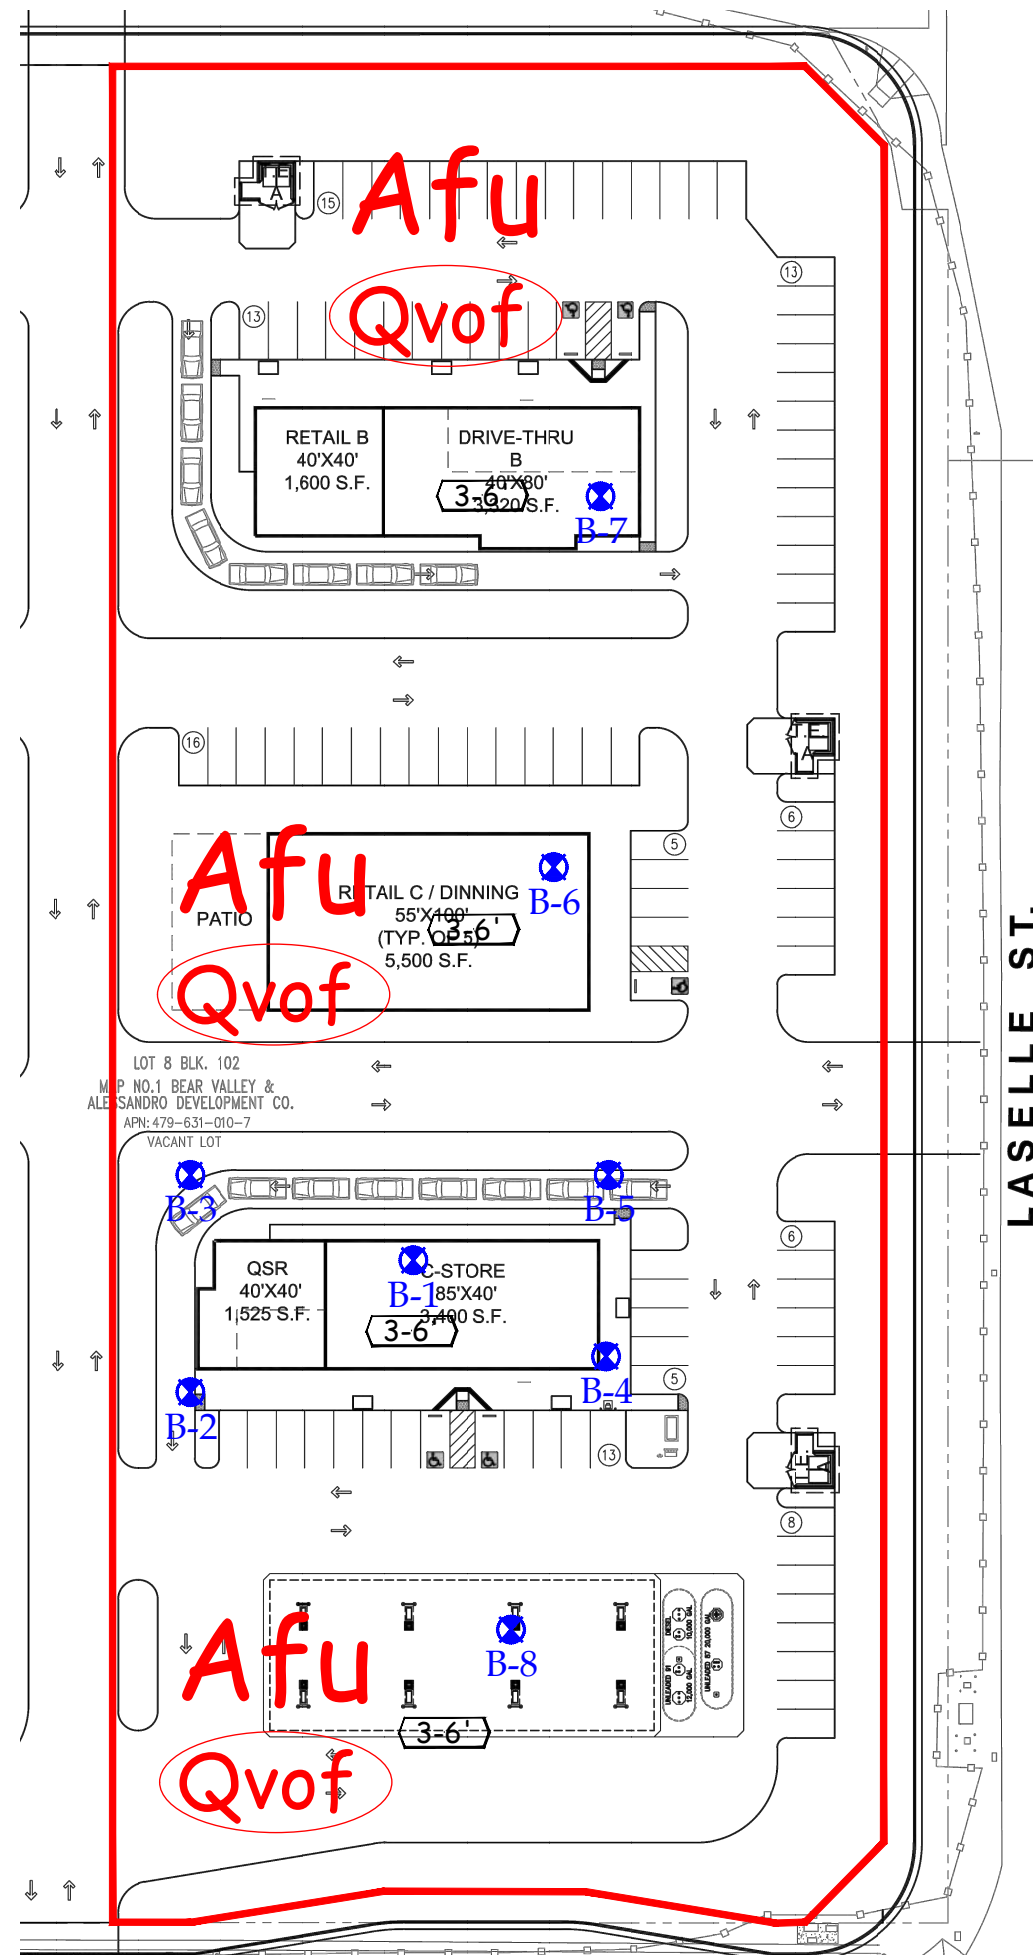

LEGEND

Locations are Approximate

Geologic Units

- Afu - Artificial Fill, Undocumented
- Qvof - Very Old Fan Deposits
(Circled Where Buried)

Symbols

- Limits of Report
- Boring Location
(By GEOBODEN INC., 2017)
- Recommended Removal Depths



GEOTECHNICAL MAP

LOCATED AT THE NORTH WEST CORNER OF ALESSANDRO BOULEVARD AND LASSELLE STREET
 CITY OF MORENO VALLEY, RIVERSIDE COUNTY, CALIFORNIA
 APN 479-631-010

| | | | |
|-------------|-----------------|-------|--------|
| PROJECT | LASSELLE STREET | | |
| CLIENT | MR. ALEX HANN | | |
| PROJECT NO. | 203131-10A | | |
| DATE | MAY 2020 | | |
| SCALE | 1:60 | | |
| DWG XREFS | | | |
| REVISION | | | |
| DRAWN BY | JDG | PLATE | 1 OF 1 |

Earth Strata Geotechnical Services, Inc.
 Geotechnical, Environmental and Materials Testing Consultants